

For the information of Surveyors and the Committee only.

Received at

Office

26. FEB. 1930

Lloyd's Register of Shipping

Order: 28448/St
Post: 24094
Best: 9886

(Report on Vessel No. 9129 Port Trieste)

M.S. Cortellazzo

No. 2027 SHIP ~~FORGINGS OR~~ CASTINGS.

I have to report that the undermentioned ~~Iron~~ Steel ~~Forgings or~~ Castings, manufactured by Messrs. Witkowitz Bergbau & Eisenh. Gew. of Witkowitz for the Vessel No. 223, being built by Messrs. Cantiere Navale Triest, of Monfalcone have been inspected by me as set forth below and found to be, so far as can be seen, 14 bed plates, sound and free from defects.

Mark on ~~Castings~~ Castings.

Reg. Ital.
Lloyd's
No. 3918
HK. 7.2.30

10225-10238

Vienna, 17th February 1930

Hans Kolbow

	B E D P L A T E S											
	1	STEERN FRAMES 1	1	RIBBER FRAMES 1	1	STEERN 1						
Material*	Siemens Martin Steel											
How made	cast		cast		cast							
If annealed	annealed		annealed		annealed							
Dimensions	to sketch		to sketch		to sketch							
Progress on Inspection	almost finished		almost finished		almost finished							
Date when Inspected	1.10.29; 7.2.30		10.10.29; 7.2.1930									
CASTINGS.	10234	10238	10227	10228	10231	10235						
Tests on Standard Test Pieces.												
Tensile Test—												
Tons per square inch	28.4	28.5	27.7	29.0	28.2	28.6	29.4	29.6	28.8	29.5	27.8	28.0
Extension per cent.	36.8	36.8	35.5	36.8	35.5	28.9	34.2	32.9	32.9	36.8	36.8	36.8
Cold Bending Test—												
Angle before fracture	120 degrees good											
Drop Test—												
Height from ground	10'		10'		10'							
Hammering Test—												
If made according to Rules and found satisfactory	satisfactory		satisfactory		satisfactory							

SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF HOLEDS OR DEFECTS

bed plate, to sk.	Tens. str. in t/sq":	Elongation in 3":	No:
"	31.3	35.5	10226
"	31.6	34.2	
"	29.5	38.2	10229
"	29.6	36.8	
"	28.8	39.5	10230
"	29.0	38.2	
"	28.6	35.5	10233
"	28.8	38.2	
"	29.5	36.8	10236
"	29.2	34.2	

Fee (if any chargeable) £ : : No: 10230: surface defect repaired by welding!

To be paid at VIENNA

* If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.

For the information of Surveyors and the Committee only.

Received at _____ Office _____ 19

Lloyd's Register of Shipping.

Order: 28448/St
Post: 24094
Best: 9886

(Report on Vessel No. 9129 Port Trieste)

No. 2027
continued!

SHIP ~~FORGINGS OR~~ CASTINGS.

At Cortellaro

The words FORGINGS or CASTINGS, IRON or STEEL, should be struck out as may be required

I have to report that the undermentioned ~~XXXXXX~~ Steel ~~Forgings or~~ Castings, manufactured by _____ of _____ for the Vessel No. _____, being built by _____ of _____ have been inspected by me as set forth below and found to be, so far as can be seen, _____

Mark on ~~XXXXXX~~ Castings.

Reg. Ital.
Lloyd's
No. 3918
HK. 7.2.30

10225-10238

Vienna, 17th February 1930

Hans Kolbow.

B E D P L A T E S I

	1 XXXXXX	1 RUDDER FRAME	1 XXXX
Material*	Siemens	Martin Steel	
How made	cast	cast	cast
If annealed	annealed	annealed	annealed
Dimensions	to sketch	to sketch	to sketch
Progress on Inspection	almost finished	almost finished	almost finished
Date when Inspected	8.11.29; 7.2.30	6.12.29; 7.2.30	13.11.29; 7.2.30
CASTINGS.	No: 10237	No: 10225	No: 10232
Tests on Standard Test Pieces.			
Tensile Test—			
Tons per square inch	29.1 28.8	29.0 29.1	28.6 28.5
Extension per cent. ... 3"	35.5 2" 40.0	34.2 3" 38.2	34.2 38.2
Cold Bending Test—			
Angle before fracture	120 degrees		good
Drop Test—			
Height from ground ...	10'	10'	10'
Hammering Test—			
If made according to Rules and found satisfactory ...	satisfactory	satisfactory	satisfactory


SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.

Fee (if any chargeable) £ : :

To be paid at VIENNA

© 2021

* If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.

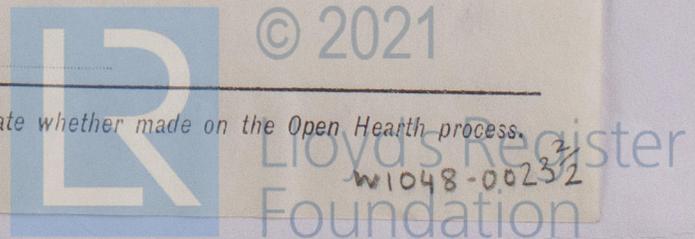

W1048-00232

Seamless, lap welded

Starting Air Rece

Seamless, lap welded