

EXTRACT OF MARSEILLES SURVEYOR'S JOURNAL.

Fri. 9th "VALENA". Compl.SS. Afloat
Berth 83


NOW DONE:- Starboard O.F. bunker satisfactorily tested by head of O.F. in filling pipe.
RECOM:B.S. to complete.-
REMARKS- The mountings of the Stbd boiler are heavily covered with salt under W.L. The vessel is to be chartered for a three months trip to the Barlados Islands.

Sun. 11th. "VALENA". Compl.B.S. Afloat.
Berth 83.

NOW DONE:-
Port Blr.-Mountings and safety valves examined.
REPAIRS:-23 stay tubes caulked.
16 plain tubes expanded.
Mountings and safety valves overhauled and placed in good condition.
Stbd.Blr.- Exd.Internally and externally together with mountings, manhole doors and safety valves.
REPAIRS.-14 stay tubes caulked.
4 plain tubes expanded.
Mountings and safety valves overhauled and placed in good condition.
REMARKS.- Hard 1/4" thick salt deposits found on furnaces and lower parts of CC tube plate and CC . The CC & tubes found chocked by soot deposits.

Mon. 12th. "VALENA". Compl.BS. Afloat
Berth 83.

Port and starboard Boiler safety valves adjusted at 180lbs W.P.
Port Blr port valve-175-178lbs
Stbd.Blr stbd valve-185-180lbs
No further adjustment made at the request of Chief Engineer.

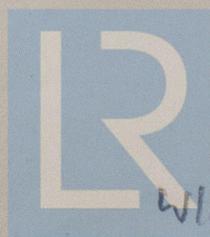

© 2020

Lloyd's Register

Foundation

W1070-0224