

For the information of Surveyors and the Committee only.

Received at \_\_\_\_\_ Office \_\_\_\_\_ 10

# Lloyd's Register of Shipping.

(Report on Vessel No. \_\_\_\_\_ Port \_\_\_\_\_)

To. 997 SHIP FORGINGS OR CASTINGS.

I have to report that the undermentioned ~~Iron or Steel Forgings or Castings~~ manufactured by Messrs. Skoda Works, Ltd. of Elzen C. S. Co. for the Vessel No. 413/414, being built by Messrs. Aktiefbolaget Gotawerken of Goteborg have been inspected by me as set forth below and found to be, so far as can be seen, sound and free from defects.

2 C. S. Propeller Brackets.

Forgings or Castings.

Lloyd's  
No. 356  
3.9.27

Prague 8<sup>th</sup> September 1927

C. R. Hughes.


	2 PROPPELLER FRAME	BRUDDER FRAME.	STEM.
Material	S. M. C. H. Steel		
Made	Cast.		
Sealed	Yes		
Dimensions	✓		
Process on Inspection	Finished machined		
When Inspected	3.9.1927		
CASTINGS.			
Tests on Standard Test Pieces.			
Tensile Test— Tons per square inch	48.8 - 48.8 : 48.5 - 47.3		
Elongation per cent.	29.0 - 29.0 : 28.3 - 27.6		
Bending Test— Angle before fracture	120°	120°	120° 120°
Height from ground	7 feet 7 feet		
Welding Test— Made according to Rules and found satisfactory	Yes, both satisfactory.		

SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.

Fee (if any chargeable) £  
To be paid at Prague.

If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.

28. T.

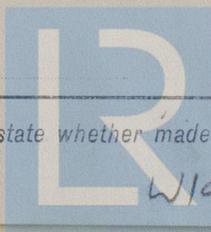

© 2020

Lloyd's Register Foundation  
W1088-0178