

10m, 11.20

Received by Chief Ship Surveyor

Received from Chief Ship Surveyor

VESSEL'S NAME Steel S.S. "MILLGATE" ex "POLTOLIA". Rpt. Mch. No. 4859. 4868.

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

Nature of Survey

Rule dimensions - 262' x 37' x 24' to upper deck.
Scantling Nos. - 61 & 15982
Proportions - Length = 10.9 depths to upper deck.

The vessel was built by Bremen Vulkan in 1905 and classed with Germanischer Lloyd.

Plans and a preliminary first entry report were examined and the vessel approved for the class 100A-. subject to additional support to the bridge deck beams being provided.

The Manchester Surveyors now report the vessel has been examined in dry dock, additional support to the bridge deck beams provided, a Special Survey No.3 carried out and repairs effected on account of damage and wear and tear.

The chain cables as required by the Rules and as on board are as follow:-

<u>Rule.</u>	<u>On board.</u>
240 fathoms $1\frac{3}{4}$ " diameter	150 fathoms $1\frac{5}{8}$ "
	90 " $1\frac{3}{4}$ "

In view of $1\frac{9}{16}$ " being the ^{mean} diameter at which the Rule Chain Cable becomes renewable, it is submitted the chain cables on board might be accepted.

The remainder of the equipment is as required by the Rules.

It is submitted the vessel appears worthy to be classed

100A1 (Steel)

2 Dks. (Steel)

Cell DBa 26' uE 18' f 110' 380t.

FK, 5BH, cem, Lloyd's A. & C.P., P37' B77' F30'

Date of build 1905


S.S. Mch. No. 3-10, 21.

10, 21 Mch.

PLATING to be DRILLED when vessel
is 24 years old, or at next special
survey thereafter.

1.11.21.

See letter 10.11.21
It is concluded hand pumps or their equivalent are fitted as required by the Rules, but the Surveyors should be requested to state if this is so.

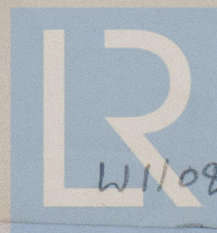

© 2020

Lloyd's Register
Foundation

W1108-0013 2/2