

10,134. H.

2

14 MAY 1942

Sent to Chief Surveyors

Received from Chief Surveyors

VESSEL'S NAME "EMPIRE SEAL"

Report Gl.s. 64419
Grk No. 64910
21711

For the CHIEF SHIP SURVEYOR and CHIEF ENGINEER SURVEYOR.

(In cases which have to be submitted to the Classing Committee "the endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case so that the Classing Committee may have all the salient points presented in the endorsement." - (Extract from Sub-Committee's Report, 24/5/32.)

A No. 3 SURVEY PARTLY HELD ADVANCED FOR RECLASSIFICATION AND DAMAGE

When due Vessel 19 years old When proposed to be completed Examined 12-41 - 12 months

Portion of Survey held, &c. The greater part.

To complete the S.S.:-

- All D.B. tanks to examined excepting Lub.oil tanks (p & s) in E.R and Nos. 3 & 4
- All D.B. tanks excepting No. 2,3 & 4 to test (ceiling to lift).
- Deep tanks to test.
- O.F. settling tanks between tunnels to test.
- Structure in way of bilges in all holds, excepting in way of D.T., to examine.

Repairs are required to the rigging on vessel's return to the U.K.
Bolts in deep tank wash plates require to be replaced by rivets at the first opportunity.

Indented shell plates D.10 (p.s) from forward and A.3 & 6 and B.6 from aft (s.s) require to be dealt with at the Owners' convenience.

Sternframe lower gudgeon T.W. 5,41 requires to be specially examined at the next dry docking.

Overall length to be ascertained.

Equipment to be verified with certificates.

A & CP to be reinstated when survey is complete also


Bulkhead particulars:- 7BH (Coll to Sh. dk 6 to upper dk) tween dk
Bhs except Coll BH dispensed with.

30.4.42

PLATING to be DRILLED when vessel is 24 years old, or at next Special Survey thereafter.

Re-Class. S.S. PART HELD.

See separate endorsement re fees.

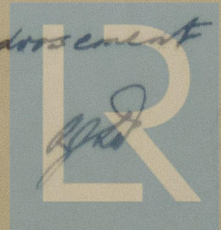

© 2020

Lloyd's Register Foundation
W1128-0003