

314

Lloyd's Agency,

St. Thomas, V.I., of U.S.A.,

25th March, 1930.

The Chief Surveyor,

"LLOYD'S REGISTER OF SHIPPING",

NEW YORK.

NEW YORK MAR 29 1930

Dear Sir,

BARGE "PEDRITO".

I am in receipt of your letter of the 14th instant, in reference to the above named craft, contents of which have been noted.

For your information I beg to advise you that the following repairs were effected whilst the vessel was on the slip here last month :-

One patch, 20" x 30" inches on plate C.I.

28 - new rivets put in.

40 - old rivets tightened.


15 feet of seam caulked.

Bottom cleaned and wire brushed and given two coats anti-corrosive and anti-fouling paint.

Stem, stern post and rudder found in good condition. Propeller blades slightly pitted at the ends. Tail shafts not below requirements.

Yours truly,

Lloyd's Agent.

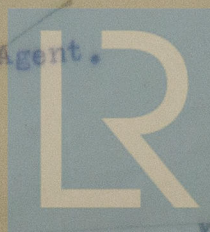

© 2020

Lloyd's Register
Foundation

W1234-018

W1234-0124 1/2