

COPY.

Lloyd's Register of Shipping.

Port Fremantle, W. A.

4th September, 1931.

This is to Certify that

the undersigned Surveyor to this Society did at the request of
The Master & Marine Superintendent,

Survey the Steel Twin Screw Steamer "Gascoyne" of London 3850 tons
Register for the purpose of verifying the information receive-
relative to the loss of the Starboard Anchor and 50 fathoms of
Cable while heaving at Carnarvon during the voyage to Fremantle,
ended 1st September, 1931.

For further particulars see Log Book.

It is stated that the Anchor and Cable are lost in ap-
proximately 18 (eighteen) feet of water, and that the local fish-
men are employed in dragging for them. Later advices are to the
effect that they have been successful in attaching a grapnel to
the chain and this will be buoyed until such time as the Steamer
"Gascoyne" arrives at Carnarvon to effect their complete recovery
during her next voyage to Singapore.

ON EXAMINATION it was found that the measurements of the Stud
links coincided with the sizes given in the Lloyd's Certificate
(Proving House Certificate) and also that the Bower Anchor had been
ready shipped to the remaining (approximate) 70 (seventy) fathoms
of Cable.

RECOMMEND that, in the event of the lost Anchor and attached Ca-
ble being recovered it be shipped to the remaining Cable with the
addition of a further fifteen fathoms of Cable to compensate for
the lost section broken between the 45 and 60 fathom Shackles.


In the event of the lost Anchor and Cable not being re-
covered, it is recommended that a new length of Cable of 60 (sixty)
fathoms be attached to the Bower Anchor and to the remaining 70
fathoms, at the earliest opportunity.

CERTIFICATE I have transmitted to the Committee of Lloyd's Re-
gister of Shipping, London, a Report, stating that this ship be
retained as Classed, subject to the abovementioned Recommendations
being put into effect at the earliest opportunity.

Wm J. Davies

SURVEYOR TO LLOYD'S REGISTER.

certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—
the Committee use their best endeavours to ensure that the functions of the Society are properly executed, it is
understood that neither the Committee nor the Society are under any circumstances whatever to be held responsible for
any error in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other
document of the Society, or for any error of judgment, default, or negligence of the Surveyors, or other Officers or Agents

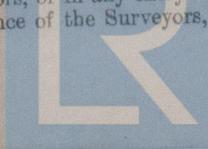

Lloyd's Register
Foundation