

REPORT ON STEAM TURBINE MACHINERY.

Received at London Office 27 SEP 1932

Date of writing Report 31-3-32 When handed in at Local Office Apr. 10th 1932 Port of Kobe
No. in Survey held at Kobe Date, First Survey 11th Nov: 1931 Last Survey 28th March 1932
Reg. Book. 3/5 (Nagasaki Yard No. 503)
Built at Nagasaki By whom built Mitsubishi Zosen Kaisha Ltd. Yard No. 503. When built
Engines made at do By whom made do Engine No. do When made
Boilers made at do By whom made do Boiler No. do When made
Shaft Horse Power at Full Power 1125 Owners Ishihara Sangyo Kaiun Goshi Kaisha Port belonging to
Nom. Horse Power as per Rule 102 Is Refrigerating Machinery fitted for cargo purposes Is Electric Light fitted 1/5


TEAM TURBINE ENGINES, &c.—Description of Engines Mitsubishi Bauer Wachs. Turb. No. of Turbines Ahead one
Direct coupled, single or double reduction geared to one propelling shafts. No. of primary pinions to each set of reduction gearing One direct coupled to phase
Propelling Motors. Propelling Motors, Type
Kilowatts Volts at revolutions per minute; for supplying power for driving
Direct coupled, single or double reduction geared to propelling shafts.

ARTICULARS OF TURBINE BLADING.

Table with columns for H.P., I.P., L.P., and ASTERN. Rows include ST EXPANSION, 1st, 2nd, 3rd, 4th, 5th, 6th, 7th, 8th, 9th, 10th, 11th, 12th, 13th, 14th, 15th, 16th, 17th, 18th, 19th, 20th, 21st, 22nd, 23rd, 24th, 25th, 26th, 27th, 28th, 29th, 30th, 31st, 32nd, 33rd, 34th, 35th, 36th, 37th, 38th, 39th, 40th, 41st, 42nd, 43rd, 44th, 45th, 46th, 47th, 48th, 49th, 50th, 51st, 52nd, 53rd, 54th, 55th, 56th, 57th, 58th, 59th, 60th, 61st, 62nd, 63rd, 64th, 65th, 66th, 67th, 68th, 69th, 70th, 71st, 72nd, 73rd, 74th, 75th, 76th, 77th, 78th, 79th, 80th, 81st, 82nd, 83rd, 84th, 85th, 86th, 87th, 88th, 89th, 90th, 91st, 92nd, 93rd, 94th, 95th, 96th, 97th, 98th, 99th, 100th.

Shaft Horse Power at each turbine 1125 Revolutions per minute, at full power, of each Turbine Shaft 3200 1st reduction wheel abt: 453
Pitch Circle Diameter, 1st pinion 232.94 2nd pinion 407.35 1st reduction wheel 1726.05 main wheel 2209.35
Distance between centres of pinion and wheel faces and the centre of the adjacent bearings,
Flexible Pinion Shafts, diameter 1st 223.74 2nd 390.83
Propelling Motor Shafts, diameter at bearings
Tunnel Shafting as per rule 354 as fitted 365
Thrust Shafting as per rule 372 as fitted 425
Screw Shaft as per rule Is the screw shaft fitted with a continuous liner the whole length of the stern tube Is the after end of the liner
If the liner is in more than one length are the joints burned If the liner does not fit tightly at the
between the bearings in the stern tube, is the space charged with a plastic material insoluble in water and non-corrosive If two liners are fitted, is the
lapped or protected between the liners Is an approved appliance fitted at the after end of the shaft to permit of it being efficiently
Length of Stern Bush Diameter of Propeller
No. of Blades State whether Moveable Total Surface square feet. If Single Screw, are
arrangements made so that steam can be led direct to the L.P. Turbine, and either the H.P. or I.P. Turbine can exhaust direct to the Condenser
Total number of power driven Main and Auxiliary Pumps
No. and size of Pumps connected to the Main Bilge Line
No. and size of Ballast Pumps No. and size of Lubricating Oil Pumps, including
Are two independent means arranged for circulating water through the Oil Cooler No. and size of suction
connected to both Main Bilge Pumps and Auxiliary Bilge Pumps;—In Engine and Boiler Room and in Holds, &c.
No. and size of Donkey Pump Direct Suctions
Are all the bilge suction pipes in holds and tunnel well fitted with strum-boxes
Bilge Suctions in the Machinery Space led from easily accessible mud-boxes, placed above the level of the working floor, with straight tail pipes to the bilges
All connections with the sea direct on the skin of the ship Are they Valves or Cocks
Are they fixed sufficiently high on the ship's side to be seen without lifting the stokehold plates Are the Discharge Pipes above or below the deep water line
Are they each fitted with a Discharge Valve always accessible on the plating of the vessel Are the Blow Off Cocks fitted with a spigot and brass covering plate
Pipes are carried through the bunkers How are they protected
Pipes, Cocks, Valves, and Pumps in connection with the machinery and all boiler mountings accessible at all times
arrangement of valves and their connections such as to prevent the possibility of water passing from the sea or from water tanks into the cargo or machinery spaces, or from one
to another Is the Screw Shaft Tunnel watertight Is it fitted with a watertight door worked from

ERS, &c.—(Letter for record) Total Heating Surface of Boilers
No. and Description of Boilers Working Pressure

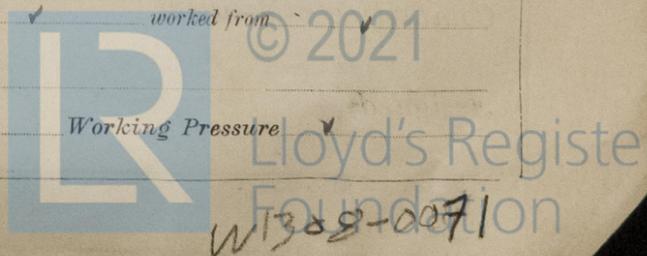

Is a Report on Main Boilers now forwarded?

If so, is a report now forwarded?

Is a Donkey Boiler fitted?

Plans. Are approved plans forwarded herewith for ^{EXHAUST TURBINE & GEAR} Shafting No. 8-10-31 Main Boilers

Auxiliary Boilers

Donkey Boilers

Spare Gear. State the articles supplied:—

(Spare gear to be checked at Nagasaki Works)

The foregoing is a correct description,
KOBE SHIPYARD & ENGINE WORKS, M.Z.K LTD.
Manufacturer.

Signed by TOKUZO MASE
SUPERINTENDENT ENGINEER

Dates of Survey while building: During progress of work in shops -- 1931 Nov. 11. Dec. 4. 10. 12. 19. 1932, Jan. 19. 20. Feb. 1. 15. 17. 23. 29 March 2. 4. 7. 10. 23. 25
During erection on board vessel --
Total No. of visits 19.

Dates of Examination of principal parts: Casings 2-3-32 Rotors 12-12-31 Blading 24-3-32 Gearing 10-3-32

Wheel shaft 10-3-32 Thrust shaft 24-3-32 Tunnel shafts Screw shaft Propeller

Stern tube Engine and boiler seatings Engines holding down bolts

Completion of pumping arrangements Boilers fired Engines tried under steam

Main boiler safety valves adjusted Thickness of adjusting washers

Material and tensile strength of Rotor shaft H.T. Steel 57.2L. 58.2C Kg/mm² Identification Mark on Do. LLOYD'S No. 491 R 24-3-32 H.D.B.

Material and tensile strength of Flexible Pinion Shaft Nickel Steel 65.3L. 63.7C do Identification Mark on Do. LLOYD'S No. 493 R 10-3-32 H.D.B.

Material and tensile strength of Pinion shaft Nickel Steel 65.3L 65.C do Identification Mark on Do. LLOYD'S No. 489 R 24-3-32 H.D.B.

Material and tensile strength of 1st Reduction Wheel Shaft S.M. steel 44.9 do Identification Mark on Do. LLOYD'S No. 571 R

Material of Wheel shaft Q.H. Steel Identification Mark on Do. LLOYD'S No. 486 R 10-3-32 H.D.B. Material of Thrust shaft Q.H. Steel Identification Mark on Do. LLOYD'S No. 319 24-3-32 H.D.B.

Material of Tunnel shafts Identification Marks on Do. Material of Screw shafts Identification Marks on Do.

Material of Steam Pipes Test pressure Date of test

Is an installation fitted for burning oil fuel Is the flash point of the oil to be used over 150° F.

Have the requirements of the Rules for carrying and burning oil fuel been complied with

Is this machinery a duplicate of a previous case No If so, state name of vessel

General Remarks (State quality of workmanship, opinions as to class, &c.)

This machinery has been constructed under special survey in accordance with the Rules & approved plans, the materials have been tested, found efficient & the workmanship throughout is good. The turbine was tried on test bench at 3,200, 3,480 & 3,800 revs per min. no load.

This case is eligible, in my opinion, for the notation of Lloyd's + L.M.C. in Register Book when the machinery has been installed on board & tried under full load working conditions. This machinery has now been shipped to Nagasaki where it is intended to be fitted on board. Yard No 503.

The amount of Entry Fee ... £ When applied for, 2nd March 1932
Special $\frac{4}{5}$ of 783 = ... ¥EN 307⁰⁰ :
Donkey Boiler Fee ... £ When received, 19...
Travelling Expenses (if any) ¥EN 20⁰⁰ :

A.D. Buchanan
Engineer Surveyor to Lloyd's Register of Shipping.

TUE. 4 OCT 1932

Committee's Minute

Assigned

See Vol. 3E 1845



© 2021

Lloyd's Register Foundation

COPY

Certificate (if required) to be sent to...
(The Surveyors are requested not to write on or below the space for Committee's Minute.)

Rpt
Date of
No. i
Reg. B
68128
Master
Engine
Boilers
Nomina
MUL
Manufa
Total H
No. and
Tested
Area of
Area of
n case
smallest
smallest
argest
ickness
ng. sea
percenta
percenta
ickness
aterial
ngth of
mension
d plat
w are
be plat
in pitc
ders to
centre
ach
site str
h of st
king p
kness
h of st
king F
eter {
ing p
eter {