

# ACKNOWLEDGMENT OF CABLEGRAM.

## Lloyd's Register of Shipping.


71, Fenchurch Street, E.C.3.

CABLEGRAM: Date of Receipt 8.1.37

Received from the Surveyor at ~~xxxxxxxxxx~~ Mr. McCowan at Port Pirie.

78148 - "KINGSWOOD"

ALRIZ - Auxiliary boiler  
SYLGY - wedged  
ACIWO - against  
EPANX - collision bulkhead(s)  
ACLYL - all  
JYETS - forward  
ENYMU - bulkhead(s)  
MOVGO - partial(ly)  
ETOJI - carried away  
FEZPE - damage sustained on starboard bow  
IBHUR - plating above light line  
UHPUL - 6  
PAHYC - shell plate(s)  
KUFKO - holed forward  
UHRUM - 11  
JYMRI - frames damaged  
SAZPO - STOP  
LUCOZ - Machinery and boiler(s)  
PALJL - shifted  
OLUVO - require to be removed (from ..)  
OSMYV - require to be refitted  
OSLYV - require to be partly renewed  
FOMUF - turbine(s) damaged  
ADIMT - and  
FIBXI - considerable damage  
JUMIX - fittings  
IFPUP - engine and boiler space  
OSFUM - require to be cleared  
KYIHR - in order (to)  
AHORX - ascertain  
FIDFY - extent of damage  
OCMUH - recommend  
SIBDU - temporary repairs  
PEZUX - so that  
NOEPT - vessel may proceed in tow  
NEUVU - repairing port

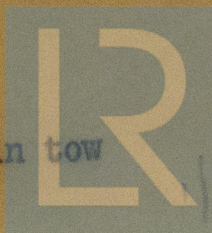

© 2020

Lloyd's Register  
Foundation



ACKNOWLEDGMENT OF CABLEGRAM.

Lloyd's Register of Shipping.

71, Fenchurch Street, E.C.3.

CABLEGRAM: Date of Receipt 8.1.37

Received from the Surveyor at ~~XXXXXXXXXX~~ Mr. McCowan at Port Pirie.

(Continued.)

KYKWU - in the meantime  
NOVKI - propose  
GOGSY - draw  
RYVGI - specification(s)  
SIMIX - (?)SIMIZ - obtain tender(s) for  
OMEWB - permanent repairs  
NIXOV - probably  
ICWEH - economical  
MEUTL - obtain from  
ENVEZ - Builders  
ALRIZ - auxiliary boiler  
IJLUC - cylinder(s) all engines  
IGWAW - H.P. back column  
IGWOB - I.P. back column  
IGXAX - L.P. back column  
NUTOC - air and water circulating pump(s)  
NYCIN - independent feed pump(s) (main boiler)  
AMAZU - forced draught  
LAGXY - installation(s)



© 2020

Lloyd's Register  
Foundation