

REPORT ON ELECTRIC LIGHTING INSTALLATION. No. 8266

Port of MIDDLESBRO' Date of First Survey White Date of Last Survey Building No. of Visits ✓
 No. in Reg. Book 562 on the Iron or Steel SS & D. Iron Port belonging to Hull
 Built at Middlesbrough By whom Mr. Raylin & Son Ltd When built 1913
 Owners Penaby & Cadeby Main Collieries Ltd Owners' Address Hull
 Yard No. 584 Electric Light Installation fitted by Messrs. Charles Chapman & Co. Ltd When fitted 1913

DESCRIPTION OF DYNAMO, ENGINE, ETC.

One single cylinder double acting open type vertical engine direct coupled to a continuous current compound wound dynamo.
 Capacity of Dynamo 100 Amperes at 100 Volts, whether continuous or alternating current continuous
 Where is Dynamo fixed in Engine Room Whether single or double wire system is used double
 Position of Main Switch Board near Dynamo having switches to groups A B C D E of lights, &c., as below
 Positions of auxiliary switch boards and numbers of switches on each each light & group of lights provided with switches as required

If fuses are fitted on main switch board to the cables of main circuit yes and on each auxiliary switch board to the cables of auxiliary circuits yes and at each position where a cable is branched or reduced in size yes and to each lamp circuit yes
 If vessel is wired on the double wire system are fuses fitted to both flow and return wires or cables of all circuits including lamp circuits yes
 Are the fuses of non-oxidizable metal yes and constructed to fuse at an excess of 50 per cent over the normal current
 Are all fuses fitted in easily accessible positions yes Are the fuses of standard dimensions yes If wire fuses are used are permanent instructions fitted on or near each switch board giving particulars of proper size of fuse for each circuit yes
 Are all switches and fuses constructed of incombustible materials and fitted on incombustible bases yes slate & porcelain
 Total number of lights provided for 117 - 16 C.P. arranged in the following groups:—

A	18	lights each of	16	candle power requiring a total current of	10.1	Amperes
B	12	lights each of	16	candle power requiring a total current of	6.7	Amperes
C	26	lights each of	16	candle power requiring a total current of	14.5	Amperes
D	25	lights each of	16	candle power requiring a total current of	14	Amperes
E	36	lights each of	16	candle power requiring a total current of	20.1	Amperes
2	Mast head light with	1	lamps each of	32	candle power requiring a total current of	1.2
2	Side light with	1	lamps each of	32	candle power requiring a total current of	1.2
6	Cargo lights of	6	16	candle power, whether incandescent or arc lights	incandescent	

If arc lights, what protection is provided against fire, sparks, &c. —

Where are the switches controlling the masthead and side lights placed in Wheel House

DESCRIPTION OF CABLES.

Main cable carrying 100 Amperes, comprised of 37 wires, each 16 S.W.G. diameter, 1.1680 square inches total sectional area
 Branch cables carrying 20.1 Amperes, comprised of 7 wires, each 17 S.W.G. diameter, 0.1695 square inches total sectional area
 Branch cables carrying 14 Amperes, comprised of 7 wires, each 20 S.W.G. diameter, 0.0700 square inches total sectional area
 Leads to lamps carrying .5 Amperes, comprised of 1 wires, each 18 S.W.G. diameter, 0.0781 square inches total sectional area
 Cargo light cables carrying 3.3 Amperes, comprised of 168 wires, each 38 S.W.G. diameter, 0.0502 square inches total sectional area

DESCRIPTION OF INSULATION, PROTECTION, ETC.


Vulcanized india rubber taped & braided & lead covered where exposed lead covered & steel armored

Joints in cables, how made, insulated, and protected no joints except mechanical ones

Are all the joints of cables thoroughly soldered, and the flux used not containing acids or other corrosive substances yes Are all joints in accessible positions, none being made in bunkers, cargo spaces, or spaces which may at any time be used for carrying cargo, stores, or baggage yes no

Are there any joints in or branches from the cable leading from dynamo to main switch board no

How are the cables led through the ship, and how protected lead covered & steel armored run through beams & clipped to underside of deck with strong galvanized iron clips

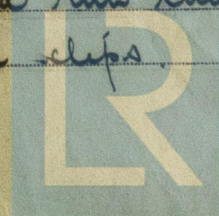

DESCRIPTION OF INSULATION, PROTECTION, ETC.—continued.

Are they in places always accessible no

What special protection has been provided for the cables in open alleyways or where exposed to weather or moisture lead lined & steel
armoured

What special protection has been provided for the cables near galleys or oil lamps or other sources of heat lead lined & steel armoured

What special protection has been provided for the cables near boiler casings " " "

What special protection has been provided for the cables in engine room " " "

How are cables carried through beams in lead bushes through bulkheads, &c. in W.T. glands

How are cables carried through decks in galvanized iron deck tubes

Are any cables run through coal bunkers no or cargo spaces yes or spaces which may be used for carrying cargo, stores, or baggage yes

If so, how are they protected lead lined & steel armoured

Are any lamps fitted in coal bunkers or spaces which may at times be used for cargo, coals, or baggage no

If so, how are the lamp fittings and cable terminals specially protected —

Where are the main switches and fuses for these lights fitted —

If in the spaces, how are they specially protected —

Are any switches or fuses fitted in bunkers no

Cargo light cables, whether portable or permanently fixed portable How fixed to W.T.C. connection boxes

In vessels fitted on the single wire system, how is the dynamo terminal fixed to the hull of vessel double wire system

How are the returns from the lamps connected to the hull —

Are all the joints with the hull in accessible positions —

Is the installation supplied with a voltmeter yes, and with an amperemeter yes, fixed in bulkhead

VESSELS BUILT FOR CARRYING PETROLEUM.

In vessels built for carrying petroleum, are all switches and fuses fitted in positions not liable to the accumulation of petroleum vapour or gas —

Are any switches, fuses, or joints of cables fitted in the pump room or companion —

How are the lamps specially protected in places liable to the accumulation of vapour or gas —

The copper used is guaranteed to have a conductivity of not less than that of the Engineering Standards Committee's standard, and the wires are protected by tinning from the sulphur compounds present in the insulating material.

Insulation of cables is guaranteed to have a resistance of not less than 600 megohms per statute mile at 60° Fahrenheit after 24 hours' immersion in water, the test being made after one minute's electrification at not less than 500 volts and while the cable is still immersed.

The foregoing statements are a correct description of the Electric Light installation fitted by us on this vessel and we declare that it is at this date in good order and safe working condition.

For Clarke, Chapman & Co. Ltd.

Electrical Engineers

Date

Jan 23rd 1914

COMPASSES.

W. Walker Chairman.

Distance between dynamo or electric motors and standard compass 96 ft

Distance between dynamo or electric motors and steering compass 88 "

The nearest cables to the compasses are as follows:—

A cable carrying	Amperes	feet from standard compass	feet from steering compass
.5	12	6	
.5	6	12	

Have the compasses been adjusted with and without the electric installation at work at full power yes

The maximum deviation due to electric currents, etc., was found to be nil degrees on all course in the case of the

standard compass and nil degrees on all course in the case of the steering compass.

FOR SIR RAYLTON DIXON & COMPANY, LIMITED,

John Robson

Builder's Signature.

Date

Jan 26-1914

GENERAL REMARKS.

Director

This Electric Light Installation has been fitted on board in accordance with the Rules, and tried under full working conditions with satisfactory results.

It is submitted that this vessel is eligible for

THE RECORD. Elec. light.

JWD 29/1/14

Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.