

1

18 FEB 1941

Sent to Chief Surveyors.....

Received from Chief Surveyors.....

VESSEL'S NAME....."ALMEDA STAR".....Report.....Liv.....No.....115572


For the CHIEF SHIP SURVEYOR and CHIEF ENGINEER SURVEYOR.

(In cases which have to be submitted to the Classing Committee "the endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

Nature of Survey.....**DAMAGE**.....When due.....

Subject to indented plates B.3 (p.s.f) and A.5 (s.s.a) being dealt with at the Owners' convenience and to permanent repairs to buckled floors at after end of No. 6 tank (p & s) at the first convenient opportunity. Also to permanent repairs to indented shell plates H.6, 7, 8 and 9 and J.6, 7, 8 and 9 and deck in way etc. (p.s); indented No. 2 stem plate from top; indented No. 3 stern counter plate from top; shell plates L.1, N.1, O.3 & 4, poop deckhouse etc. (p.s); indented shell plates No. 6 and doubling in 1st strake below sheer, No. 5 plate and doubling in 1st below sheer, Nos. 6 & 8 plates in 2nd below sheer and Nos. 6 & 7 plates in 3rd below sheer etc. (s.s); indented shell plate No. 2 from aft in sheerstrake and indented and fractured Nos. 2 & 3 plates in 1st strake below (s.s), all at the Owners' convenience, and to repairs to indented shell plates L.6, O.2, 3 & 4 (s.s), together with poop deckhouse, side plating etc. at the first convenient opportunity, also to tiller, E.W. 1.41, being specially examined on vessel's return to U.K.

"Presumed lost"

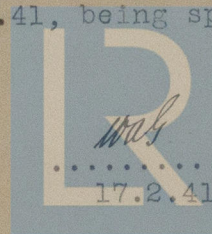

© 2020

Lloyd's Register
Foundation

17.2.41.

W329-0119