

Total under Upper Dk. 5791.8
Do. of Poop
Or. Dk. 567

Depth, at middle of length from top of
beams at side of uppermost Continuous Deck }
When this does not exceed 8ft. - 8.00
81.25

Built at IRVINE
When built 1920 Launched 12.
By whom built AYRSHIRE DOCKYARD
CAYZER IRVINE

WED. DEC. 15 1920

GLASGOW.
10th November, 1920.

RETAIN

William McC. Meek,
Surveyor to Lloyd's Register.

Messrs. The Ayrshire Dockyard Co., Ltd., Irvine,
Survey the new Steel Screw Steamer "CLAN MACNAB", approximate
Gross Tonnage 5930, as she lay afloat in the Princes Dock,
Glasgow, in connection with damage alleged to have been
sustained through the S.S. "ARSTERTURN" of London, 5035 Tons
Gross Register (The Turnbull Scott Shipping Co., Ltd.,) bearing
down upon her while shifting berth on the 6th November, 1920.

On the 8th November, 1920, the undersigned found
that the ogee plate from the after end of the Forecastle Deck
to the top of the bulwark on the Starboard Side, together with
the bulkhead frame bar in this vicinity, indented and fractured,
and the moulding at the after end of the Forecastle Deck torn
away; on the Starboard Side aft one bulwark stay wrenched
from the bulwark and stringer plates and the bulwark plate in
the vicinity buckled.

In order to place the vessel in the same good
condition as she was in prior to the accident the undersigned
recommended that the ogee plate, frame bar and moulding at the
after end of the Forecastle Deck be renewed; that the bulwark
stay on the Starboard Side aft be renewed and the bulwark plate
refaired in place.

© 2019
Lloyd's Register
W377-0257(1/2) 16 36
1/2 x 3 1/2 x 36
STEEL 6x30 & TEAK
Forecastle Deck Stringer Plate, b'dth & th'kns 35 34

Do. of Poop
Do. of R. Qr. Dk.
Do. of Bridge Ho.
Do. of

81-25 When built 19 20 Launched 12-
By whom built AYRSHIRE DOCK
CAYZER IRVINE

-2-

WED. DEC. 15 1920

It was further recommended that all rivets and caulking in the vicinity of the afore-mentioned damage (1) forward, (2) aft, be tested, hardened up or renewed as found necessary.

Surveyor to Lloyd's Register.

FEE:- £2: 2: 0.


RETAIN

ridge Deck, Angle, Bulb Angle, r max,
Tee Bulb or Channel

Angles on upper edge

Spacing

Forecastle Deck Stringer Plate, b'dth & th'kns

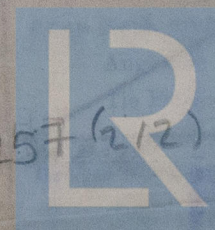

© 2019

Lloyd's Register
Foundation