

## Lloyd's Register of Shipping.

## SURVEYS FOR FREEBOARD-STEAM SHIPS.

PARTICULARS RELATING TO ALL STEAM SHIPS EITHER FLUSH DECKED, OR WITH TOP GALLANT FORECASTLES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR WITH TOP GALLANT FORECASTLES HAVING LONG POOPS, OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey Sunderland  
Date of Survey While building  
Name of Surveyor F. Urwin

Ship's Name.  
**STREONSHALH**Port of Registry  
and Nationality.  
Whitby  
BritishOfficial  
Number.  
137090Gross  
Tonnage.Date of Build.  
1928Particulars of Classification.  
\* 100 A1 Contemplated.

Number in Register Book

Registered dimensions from Ship's Register.	LENGTH.	BREADTH.	DEPTH.	UNDER DECK TONNAGE.
	<u>349.4</u>	<u>50.1</u>	<u>23.8</u>	<u>3475.61</u>
Length on LOADLINE.	<u>348.5</u>			
		Frame Depth 12" Rule <u>54.6</u>	Ceiling + 20" Sheer + 1.05	Peak Tanks { Included
		2 x 6" = -1.08	Span ceiling fitted Sank level	Rising line forward +.63
	<u>348.5</u>	<u>49.102</u>	<u>25.05</u>	<u>3476.24</u> <u>3471.44</u>

Efficient of fineness.....

Modification necessary

Para. 4 (a) to (e)\*

Efficient as corrected .....

Stem..... 108  
Sternpost... 59  
 $167 \div 2 = 83.5$  Mean 36.37.88  
1.05

At  $\frac{1}{2}$  of the length from { Stem 59.5  
Sternpost 31.5 }  $91 \div 2 = 45.5$  Mean 82.73  
45.5 = 82.73

Dual mean Sheer ..... 82.73  
Standard mean Sheer [Table, Para. 18] ..... 44.85  
Difference..... 37.88  $\div 4 = 9.47$   
Correction - 9.47

If limited as Para. 18 (f) ..... - 9.47

Fall in Sheer { At front of bridge house.....  
amidships {  
Para. 18 (e) { At after end of forecastle ..... ☒

Fall in Sheer {  
Para. 18 (d) {  $\div 2 =$

Length uncovered .....  
Correction ☒

## ALLOWANCE FOR DECK ERECTIONS :-

Freeboard, Table C..... 2.11  
Correction for Length, if required (Para. 12, 13, and 14) ..... + 2.34  
3.134

Freeboard by Table A, corrected for sheer, and for length, if required (Para. 11, 12, 13, and 14) ..... 5.74

Difference ..... 2.5424  
Percentage as below..... 31%  
 $\frac{31 \times 24.50}{100} = 7.595$   
9.14  
31.09  
9.09

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11) ..... - 9.47

Allowance for Deck Erections ..... - 9.47

	Length.	Length allowed.	Height.
Forecastle.....	<u>30.78 + 4.5 rising houses</u>	<u>32.00</u>	<u>8.0</u>
Bridge House.....	<u>105</u>	<u>105.00</u>	<u>8.0</u>
Raised Qr. Dk.....			
Top.....	<u>32.72</u>	<u>32.72</u>	<u>8.0</u>
Total .....		<u>169.72</u>	<u>48.70</u>
Length of Ship .....		<u>348.50</u>	
Corresponding percentage { (Para. 11, 12, 13, and 14) {	<u>31%</u> <u>31.09%</u>		

FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Steel) Deck :-

Fresh Water Line	above centre of Disc	...	...	...	...	...	...	...	...
Indian Summer Line	"	"	"	"	"	"	"	"	...
Winter Line	below	"	"	"	"	"	"	"	...
Winter North Atlantic Line	"	"	"	"	"	"	"	"	...

12 JUN 1928

If the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.  
In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R.Q.D. is to be taken from the level of the top of the amidship beam.  
In flush-decked vessels the total standard mean sheer means the sheer measured at the stem and sternpost. In vessels having poops and forecastles, it means the sheer measured at points distant one-eighth of the vessel's length from stem and sternpost.

Moulded Depth as measured..... 25' - 10"Addition for Keel below base line  
for draught record..... 2 inches.

NOTE. - If the depth is measured when vessel is afloat, the details of measurement should be reported.

## CORRECTION FOR LENGTH.

Length of Ship on Loadline..... 348.5  
Length in Table ..... 310.0  
Difference ..... 38.5  
Correction for 10ft., Table A. .... 1.367 Table C. .7  
 $\times$  Difference divided by 10 ..... 5.3926 (if required.) 2.69  
If  $\frac{1}{10}$ ths length covered divide by 2 + 5.14 + 5.1224

## CORRECTION FOR IRON DECK.

Proportion covered, if less than  $\frac{1}{10}$ ths length covered ..... 48.70  
Thickness of usual wood deck, less stringer ..... 3 1/2  
- 1 3/4

## CORRECTION FOR ROUND OF BEAM.

Breadth at Gunwale amidships..... 49.0  
Round of Beam ..... 12 1/4  
Normal round..... 12 1/4  
Difference ..... 1/2  
Proportion of Deck uncovered (Para. 19) ..... -

NOTE. - The round of beam should be reported on the full breadth of vessel at the gunwale.

Freeboard, Table A ..... 5 - 11 1/4  
Correction for Sheer ..... - 9 1/2

Correction for Length ..... 5 - 13 1/4  
+ 5 1/2 1/4  
5 - 7 1/4  
- 9 1/4  
4 - 10

Allowance for Deck Erections ..... -  
Correction for Round of Beam..... -

Correction for fall in Sheer (if any)..... -

Correction for Steel Deck (if required) ..... - 1 3/4  
4 - 8 1/4

Additions for non-compliance with provisions of Para. 11 (d) and (e)  $\pm$  ..... -

Other Corrections (if any) ..... -

Winter Freeboard ..... 4 - 8 1/4  
Summer Freeboard A = 3 1/2, C = 5, say 4 1/2 1/4 4 - 3 3/4 1/4

Indian Summer Freeboard ..... 3 - 11 3/4  
N. A. Winter Freeboard ..... -

Correction necessary because clearside amidships, measured in accordance with the Statute is not taken at the intersection of the wood or steel deck with side. 1 3/4

Winter Freeboard from deck line ..... 4.10  
Summer " " " " ..... 4.5 1/2 3/4

Indian Summer " " " " ..... 4.1 1/2  
N. A. Winter " " " " ..... -

Winter Freeboard from deck line ..... 4.5 1/2  
Summer " " " " ..... 6  
Indian Summer " " " " ..... 4  
N. A. Winter " " " " ..... 4 1/2

State dimensions of freeing port area on back of this form.

The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draught at time of survey, and also the usual load draft forward and aft, should be reported.

Lloyd's Register

21 JUN 1928

RECEIVED

W412-0166



Do all the Frames extend to the top height in the Poop? *Yes* Raised Quarter Deck? *✓* Bridge House? *Yes* Forecastle? *Yes*  
 To what height do the Reverse Frames extend? *B. A. Framing*  
 Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? *Yes*  
 Give particulars of the means for closing the openings in Bulkhead *4 steel doors + 1 wood door to crew space.*  
 Is the Poop or Raised Quarter Deck connected with the Bridge House? *No* Has the Bridge House an efficient Bulkhead at the fore end? *Yes*  
 Give particulars of the means for closing the openings in Bulkhead *2 Hinged and bolted doors. Openings 4'-6" x 3'-6", bolt 3 1/2" apart*  
 What is the thickness of the Bridge Front plating? *.40* and Coaming plate? *.44*  
 Give scantlings and spacing of the Stiffeners *8 1/2 x 3 x .50 B.A. 30" apart*  
 Are bracket plates fitted at each end of the Stiffeners? *5 7/8 rivets* Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks? *Yes*  
 Has the Bridge House an efficient Iron Bulkhead at the after end? *Yes*  
 How are the openings closed? *Weather boards in riveted channels*  
 Is the Forecastle at least as high as the main or top-gallant rail? *Yes* Has the Forecastle an efficient Iron or Wood Bulk'd. at after end? *Yes*  
 Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse? *Yes + Casings on bridge deck.*  
 If the openings are not so protected are the exposed parts of the Casings efficiently constructed? *✓*  
 Give thickness of plating; scantlings and spacing of Stiffeners *.30 .34 coaming Stiffeners 4 x 3 x .36 spaced 3'-0" apart*  
 What is the height of the exposed Casings? *7-6 above Bv. dk* Are suitable means provided for closing all openings in them in bad weather? *Yes*  
 Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:— *✓ On Bridge deck*

Position and Size.	No 1. 29.3 x 20.0		No 2. 30.0 x 20.0		No 3. 15.0 x 20.0		No 4. 30.0 x 20.0		No 5. 30.0 x 20.0	
Item.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.
COAMING. Height above top of DECK	38"	as approved	38"	as approved	30"	as approved	38"	as approved	38"	as approved
Thickness	Sides.....	.44	.44	do	.44	do	.44	do	.44	do
	Ends.....	.44	.44	do	.44	do	.44	do	.44	do
SHIFTING BEAMS OR WEB PLATES.	Number .....	4	4		2		4		4	
	Section and Scantlings .....	19 3/4 x .38	20 x .38	do	13 x .36	do	20 x .38	do	20 x .38	do
	Material .....	4 x 3 x .44 angles	4 x 3 x .44 angles		4 x 3 x .44 angles		4 x 3 x .44 angles		4 x 3 x .44 angles	
* FORE AND AFTERS.	Number .....									
	Section and Scantlings .....									
	Material .....									
HATCHES Thickness .....	3	do	3	do	3	do	3	do	3	do
Remarks.....	Good		Good		Good		Good		Good	

\* The depth of Fore and Afters should be stated from the underside of the hatches in all cases.

(If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.

What is the thickness of the Bridge Sheerstrake? *.53* Strake between Main and Bridge Sheerstrakes? *.53*

Delete the words { The Crew ~~are~~, are not, berthed in the bridge house.


that do not apply { The arrangements to enable them to get backwards and forwards from their quarters are, ~~are not~~ satisfactory.

Length of Bulwarks in well *85'-6" forward 90'-0" aft.*

Area of Freeing Ports required by Para. 11 (e) each side of vessel = *35.1* Sq. ft.

Ft. Tenths. Ft. Tenths. No. *18* Freeing Ports (each side of vessel) = *36.0* Sq. ft.

Total deficiency or excess = *.9* Sq. ft.

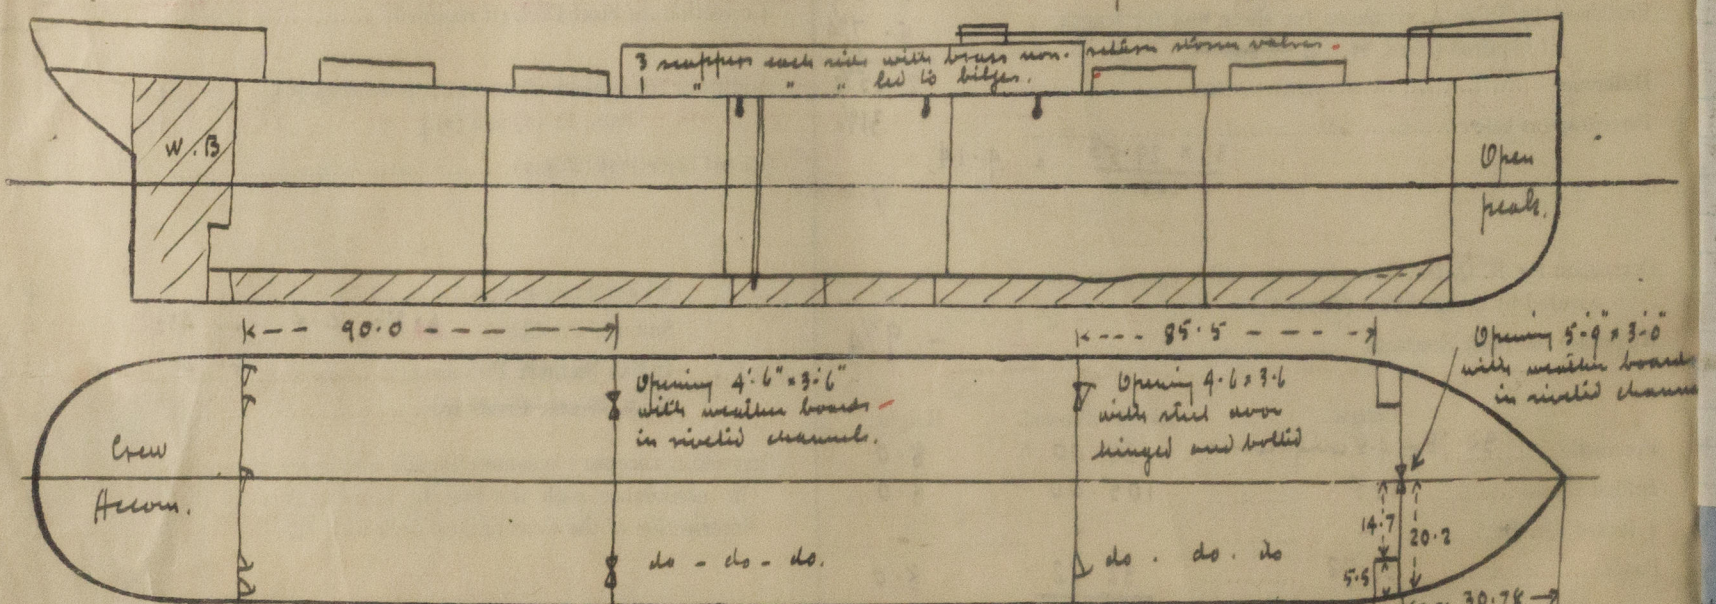

Show hereon line of Floors or Tank Top with position of any Breaks in same; also height of Peak Tank tops, &c., &c.

State any special features in the construction of the Vessel *✓*

Builder's name and yard number *Wm Pickersgill & Sons Ltd. Yard No 222.*

Names of sister vessels *✓*

Owners *Rowland & Manswood S.S. Co. Ltd.*

Address *43 Flowergate, Whitby*

Fee £ *8 5* Received by me

Will be charged on completion.

Displacement at 21.8 3/4 = *8739*  
 T.P.I. " " = *36.23*

Approved plans and request form are in the London office.



Lloyd's Register Foundation