

S.S. "INCHDAIRNIE".


FALMOUTH RPT. NO. 6605.

This vessel was under survey at Falmouth early last month when, on account of overheating of the H.P. Turbine thrust, the H.P. turbine complete was renewed and the old H.P. turbine was put ashore for repairs.

The vessel proceeded to sea and on account of trouble with the new thrust the vessel put back to Falmouth.

The Falmouth Surveyors now report that the original turbine has been replaced on board after the thrust collars had been turned up and the thrust bearings retalled to suit, both rotor and pinion bearings retalled and aligned, L.P. thrust retalled and the machinery tried at sea. Some alterations have been effected to the lubricating system.

IT IS SUBMITTED that the vessel is eligible to remain as classed subject to the H.P. turbine thrust and bearings being again examined on vessel's return from present voyage.

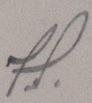

16.12.26.



© 2019

Lloyd's Register
Foundation

W482-0413