

written

1-967

17515  
DEC 8 1904

# Lloyd's Register of British & Foreign Shipping.

## SURVEYS FOR FREEBOARD.

22072

ARTICLES IN RESPECT OF STEAM SHIPS WITH TOP GALLANT FORECASTLES,  
POOPS OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES,  
SHORT POOP AND BRIDGE HOUSE DISCONNECTED, OR BRIDGE HOUSE.

Port of Survey Sunderland  
Date of Survey 7th December 1904  
Name of Surveyor Robt Howie

Thope  
Ship's Name. Thope  
Gross Tonnage. 2715  
Official Number. 118648  
Type of Ship. Single Deck and  
Date of Build. 1904

Particulars of Classification.  
100A1 (class contemplated)

Length as { 314' Breadth 46.5 Depth 20.6  
Loadline 312.17  
46.5  
156085  
187302  
124868  
14515905  
206  
870954  
903180  
902754 / 254552 (851)

Moulded Depth as measured..... 23'-0 1/2"

NOTE. - If the depth is measured when vessel is afloat, the details of measurement should be reported.

Inc. peaks  
Tons und. Dk. 2545.52  
254552  
851 x 100  
Coefficient of fineness..... 851  
Modification necessary { Cellular double bottom & deep framing = .01  
Para. 4 (a) to (e) \* 841  
Coefficient as corrected..... 851  
Highest in tables 82. ✓ 81

CORRECTION FOR LENGTH.  
Length of Ship on Loadline..... 312.17 \*  
Length in Table ..... 276.5 \*  
Difference ..... 35.67 \*

Correction for 10ft., Table A. .... 1.2 Table C. .6  
x Difference divided by 10 ..... 4.28 (if required.) 2.14  
If 1/10ths length covered and Poop or RQD is connected to Bridge divide by 2 for vessels coming under para. 11 Say + 4 1/4" \* Say 2 1/4"

CORRECTION FOR IRON DECK.  
Proportion covered, if less than 1/10ths length covered ..... 67.91  
Thickness of usual wood deck, less stringer..... 4'-2 1/2" = 3 1/2"

CORRECTION FOR ROUND OF BEAM.  
Breadth at Gunwale amidships..... 45.5  
Round of Beam..... 11 1/4  
Normal round ..... 11 3/4  
Difference ..... 3 ÷ 2 = 1 1/2

NOTE. - The round of beam should be reported on the full breadth of vessel at the gunwale.

Proportion of Deck uncovered (Para. 17) .....  
Freeboard, Table A ..... 4'-11 3/4" \*  
Correction for Sheer ..... - 7 1/2" \*  
Correction for Length ..... + 4'-4 1/4" \*  
Allowance for Deck Erections ..... + 4 1/4" \*  
Correction for Round of Beam..... - 4'-8 1/2" \*  
Correction for Iron Deck (if required) ..... - 1'-8 1/2" \*  
Additions for non-compliance with provisions of {  
Para. 11 (e) and (f) † ..... 3'-7 1/2" \*  
Other corrections (if any).....  
Winter Freeboard ..... 3'-4 1/4" \*  
Summer Freeboard ..... 3'-0 3/4" \*  
N. A. Winter Freeboard ..... 3'-6 1/4" \*

Correction necessary because clear side amidships measured in accordance with the Statutes is not taken at the intersection of the steel deck with side. + 2"

Winter Freeboard from deck line § ..... 3'-6 1/4"  
Summer " " " ..... 3'-2 1/4"  
N. A. Winter, " " " ..... 3'-8 1/4"  
ste Deck: - 3' 2 1/2" ..... 3'-2 1/2"  
..... - 5 ..... 4 3/2  
..... 3 1/2 ..... 4 3/2  
..... 3 1/2 ..... 5 1/2

ALLOWANCE FOR DECK ERECTIONS:—  
Freeboard, Table C..... 2'-8 1/4" \*  
Correction for Length, if required (Para. 12 and 13) ..... + 2 1/4" \*  
Freeboard by Table A. corrected for sheer, and for length, if required (Para. 12 and 13) ..... 4'-8 1/2" \*  
Difference ..... 1'-10 1/4" \*  
Percentage as below..... 57.91  
22' x 57.91 = 12.74 13"  
100

Correction for R. Q. Dk. less than 4ft. high, or if engine and boiler openings not covered by bridge house ✓  
Allowance for Deck Erections 12 1/2" \*  
Length. Length allowed. Height.  
Forecastle..... 29.0' ..... 29.0' ..... 7.0'  
Bridge House ..... 152.0 ..... 152.0 ..... 7.0  
Raised Qr. Dk. .... ✓ ..... 31.0 ..... 7.25  
Poop..... 31.0 ..... 212.1  
Total ..... 212.1 ..... 312.17 67.91  
Length of Ship ..... 312.17 = 67.91

Corresponding percentage { 57.91  
(Para. 11, 12, and 13.)  
FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck:—  
Fresh Water Line above centre of Disc .....  
Indian Summer Line " " " .....  
Winter Line below " " .....  
Winter North Atlantic Line " " " .....

† If the frames skin planking or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.  
‡ In vessels obtaining an allowance for deck erections under Para 11 where the sheer drops abaft amidships the height of the R.Q.D. is to be taken from the level of the top of the amidship beam.



DELETE WORDS WHICH DO NOT APPLY.

The Crew ~~are~~, ~~are not~~, berthed in the bridge house.

The arrangements to enable them to get backwards and forwards from their quarters ~~are~~, ~~are not~~, satisfactory.

Length of Bulwarks in well

Area of freeing ports required by Para. 11 (f) each side of vessel

Sq. Ft.

Freeing Ports (each side of vessel)

Ft.	Tenths.	Ft.	Tenths.	No.
	x			
	x			

Sq. Ft.

Total deficiency =

Sq. Ft.

Total excess =

"

Vertical distance from bottom of keel or from top of deck at side amidships to lower edge of lowest side scuttle.

(N.B.—This dimension need not be reported unless the sill of the lowest side scuttle would be less than 6 inches above the Indian Summer Load Line if assigned under the tables.)

Do all the Frames extend to the top height in the Poop?

Do. do. do.

in the Raised Quarter Deck?

Do. do. do.

Bridge House?

Do. do. do.

Forecastle?

To what height do the Reverse Frames extend?

Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end?

Give particulars of the means for closing the openings in Bulkhead

Is the Poop or raised Quarter Deck connected with the Bridge House?

State whether the Bridge House efficiently covers the Engine and Boiler Openings

Has the Bridge House an efficient Iron Bulkhead at the fore end?

Give particulars of the means for closing the openings in Bulkhead

Describe how and to what extent it is Stiffened, give scantlings and spacing of Angle Irons, Bulb Plates, etc.

Has the Bridge House an efficient Iron Bulkhead at the after end?

How are the openings closed?

Is the forecastle at least as high as the main or top-gallant rail?

Has the Forecastle an efficient Iron or Wood Bulkhead at its after end?

Are the Hatchways efficiently constructed?

What is the thickness of the Hatches?


State the height of the Coamings in fore well?

In after well

Are the exposed parts of the Engine and Boiler Casings efficiently constructed?

State any special features in the construction of the Vessel

Vessel built in accordance with approved midship section and profile plans forwarded herewith

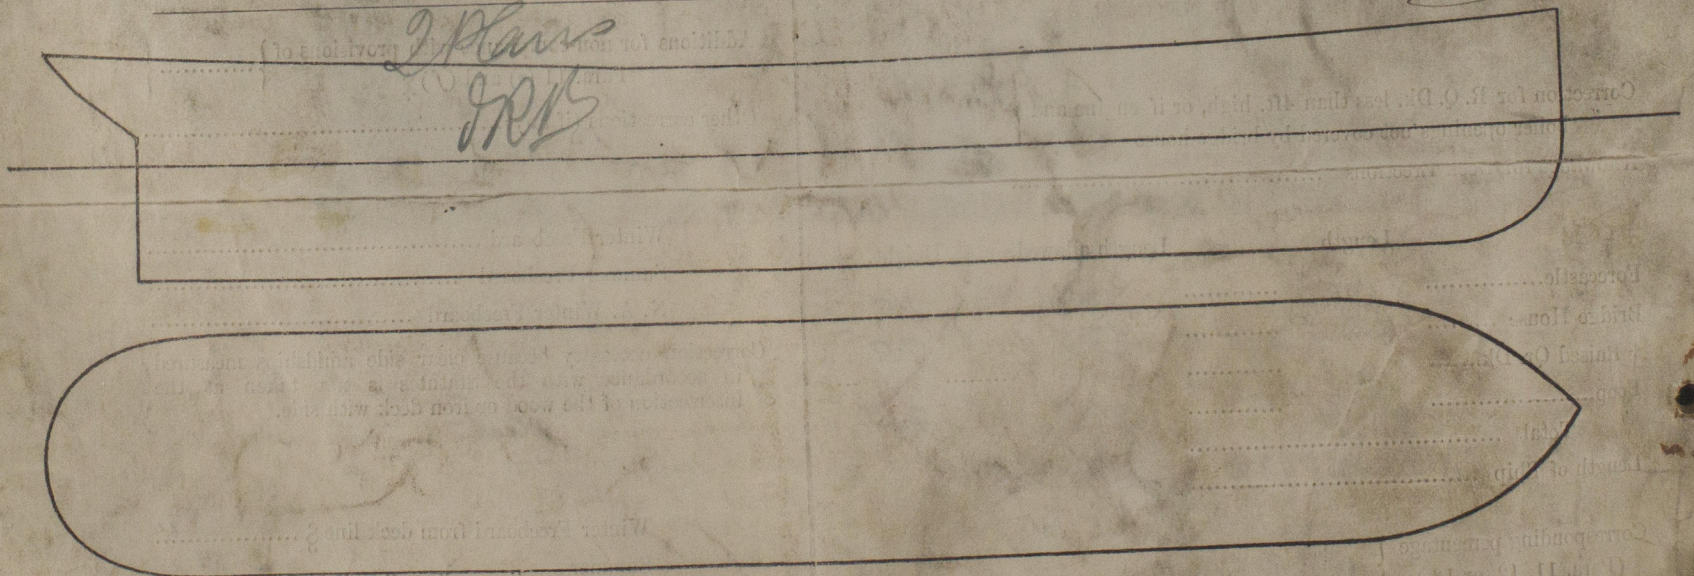

Show hereon the actual measurements of sheer, draft, erections, breaks in line of floors, &c.

Owners

Address

Fee £

Received by me



© 2020

Lloyd's Register Foundation