

FREEBOARD REPORT ON THE "LONDON TRADER".

submitted the Freeboards given on the accompanying form, those required by the Tables, merit approval, subject to:-

and hatch covers, wood fore and afters, and shoes, and battening being made good where necessary, to Surveyor's satisfaction. The steel hinged cover over Fidley Gratings being renewed. Efficient covers, tarpaulins and battening arrangements being provided for coaling hatch on casing top. Engine Room skylight flaps being made good as necessary, to Surveyor's satisfaction.

Thru-hull ventilators to after cabins being repaired as necessary, to Surveyor's satisfaction.

Efficient tarpaulins and battening arrangements being provided for scuttles on Raised Quarter Deck.

Ventilators on freeboard deck and superstructure decks being repaired to Surveyor's satisfaction, and efficient means of closing being provided for ventilator coamings on forecastle deck.

Water pipe on forecastle deck to fore peak being renewed 18 inches and supplied with satisfactory means of closing.

Scuttles to crew space in forecastle being repaired where necessary.

Life line, lifelines, or other efficient means for the protection of crew being provided in the fore well.

Decking port area in raised quarter deck bulwarks being increased to 10 sq.ft. on each side of ship.

Locks and handles of doors in forecastle front bulkhead being efficient.


Doors in machinery casings on raised quarter deck being made efficient of being operated from both sides.

J. M. M. R. G. S. K. J. B.

tion Freeboards.

11.5.32.

Asst. Genl. Officer  
11/5

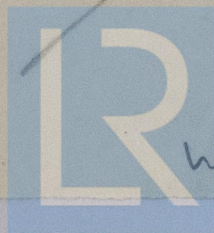

© 2020

Lloyd's Register  
Foundation