


COPY

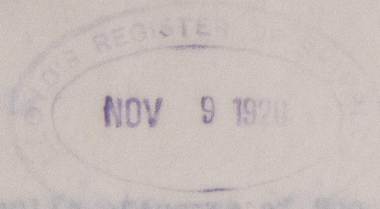

LLOYD'S REGISTER
LONDON.

REC'D 4 JAN 1921

November 9th. 1920

ANS'D

The above recommendations have now been carried out to my satisfaction.

This is to Certify that

JOHN T. S. MORRISON


Survey fee £100.00
The undersigned Surveyor to this
Travelling Society did at the request of

the Owners' Representatives, proceed on board the unclassed British
Tow Steamer "JAVARY" of London, No. 61846 in the Register Book,
November 2nd. 1920 and subsequent dates, vessel lying afloat in
Hong Kong Harbour, for the purpose of making an inspection of the
starboard Main Boiler with the view of making the necessary
recommendations for repairs to same.

Upon examination it was found that the centre combustion
chamber was leaking badly and wing combustion chambers leaking
slightly, also that the bottom starboard and top manhole doors were
not a good fit in boiler.

It was therefore recommended that:-

- (1) Welding at front seam of wrapper plate of centre combustion
chamber be cut away, rivets in way renewed and seam
caulked up.
- (2) Leaky combustion chamber stays, tubes and seams be made
tight in all combustion chambers.
- (3) Bottom starboard and top manhole doors be fitted with
rings on spigot, and doors refitted to boiler.

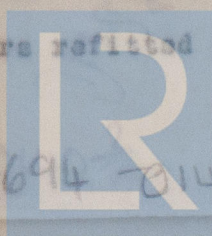

© 2021

Lloyd's Register
Foundation

W694 01407

S. S. "JAVARY"

(2)

- (4) Boiler to be tested with hydraulic pressure of 200 lbs.
on completion of repairs.


The above recommendations have now been carried out to
my satisfaction.

G. L. Morrison

SURVEYOR TO LLOYD'S REGISTER
HONGKONG

Survey fee - - - - - \$100.00

Travelling expenses \$ 25.00

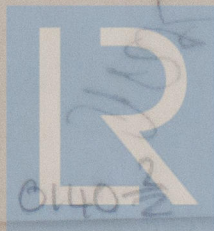

© 2021

Lloyd's Register
Foundation

W694 - 0140-2

Reference to the Civil Engineer's Certificate

Referred to the Chief Engineer Surveyor.

Referred to the Chief Engineer Surveyor.

Tam.

4 JAN 1921

Also for Mr. S. A. Hill to make.

Referred to Mr. Magno.

MR

00.001\$ - - - - \$100.00
00.33 \$ expense Billlevett



©2021

Lloyd's Register
Foundation