

of Spine
of the ship


Damara & Co

The Assicurazioni Generali proceed on the
13th Dec^r last and subsequent dates on
board the Austrian Steel Screw Steamer
Venezia

to ascertain and report upon the nature
and extent of the damage stated to
have occurred through a mooring breaking
causing the vessel to collide with the
dock wall at the Arsenal on the 13th
December last.

The vessel was found to have been
damaged in the neighbourhood of the lower
Line on the Port Bow and it was
recommended that the vessel be placed in
dry dock for further examination.

The vessel was placed in the dry
dock of the Arsenal del Lloyd Austriaco
when the following damage was found
and the accompanying recommendations
were made — — — — —

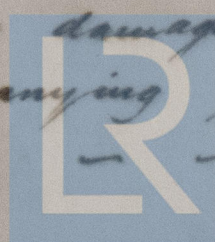

3 Shell plates indented Recommended the same be removed, faired & replaced
 3 Frames & Reverse frames set in. Recommended the frame girder be unrieveted and the frame & reverse frame be drawn out and re-rieveted
 The other two frames to be faired in place
 Side Stringer in way of above set in. Recommended the same be unrieveted and faired in place.
 One Stemp Rope broken Recommended same be renewed

To carry out the above work, it was recommended the spanning inside be removed & afterwards replaced and on completion, the whole of the work to receive two coats of the usual paint.

These repairs were recommended in order to place the vessel in the same condition as before the accident and the undersigned estimates that the cost of the repairs if carried out in this manner will be about £420, (four hundred & twenty pounds) inclusive of the docking fees.

As however time did not permit of the repairs being carried out in this manner, with the consent of the owners a satisfactory repair has been effected by the removal of one of the plates which has been replaced after being faired, and the other two shell plates have been faired in

place, a solid liner being fitted behind the frames so as to preserve the contour of the vessel. the sparring replaced and the whole of the work repainted.

£ 4. 4. 0

£ 2. 2. 0

£ 6. 6. 0

Bernard J. Lee

Surveyor to Lloyd's Register



© 2020

Lloyd's Register
Foundation