

For the information of Surveyors and the Committee only.

Received at \_\_\_\_\_ Office \_\_\_\_\_ 18

# Lloyd's Register of Shipping.

or: 355875.

(Report on Vessel No. \_\_\_\_\_ Port \_\_\_\_\_)

## CASTINGS.

3383.

## SHIP FORGINGS OR CASTINGS

I have to report that the undermentioned ~~XXXX~~ Steel ~~XXXXXX~~  
~~XXXXXX~~ castings manufactured by Messrs. Fried. Krupp A.G.  
Essen for the Vessel ~~XXX~~ "Statendam"  
Messrs. N.V. Wiltons Machinefabriek of Rotterdam  
have been inspected by me as set forth below and found to be, so far as can  
seen, 1 rudder sound and free from surface defects.-

rgings or Castings.

Lloyd's

Düsseldorf 14th June 1928.

176.

12.6.28.

1 rudder

	<del>XXXXXXXXXX</del> top part		<del>XXXXXXXXXX</del> middle part		<del>XXXX</del> sole part	
	Annealed Siemens Martin Cast Steel					
	cast		cast		cast	
Inspection ...	rough turned and finished		rough turned and finished		rough turned and finished	
Inspected	12.6.28.		12.6.28.		12.6.28.	
TINGS.	.798	3"	.798	3"	.798	3"
Standard Test						
ces.						
are inch	29,1	29,4	29,7	29,4	28,5	28,3
er cent. ...	32,0	26,0	31,3	28,7	33,3	32,0
g Test—	120 degr. good		120 degr. good		120 degr. good	
e fracture						
a ground ...	7 feet		7 feet		7 feet	
Test—						
ording to Rules	satisfactory		satisfactory		satisfactory	
d satisfactory ...						

SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.


and nuts .798 3" 29,1 Tons p.sq.inch. 37,4% elongation  
.798 3" 29,9 " " " 34,7%

(if any chargeable) £

be paid at Düsseldorf.

on, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.

State if annealed Yes.

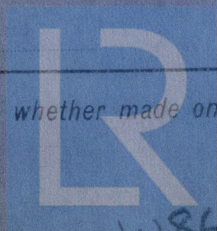

© 2019

Lloyd's Register

Foundation 330-91

W86-0033

Character Assigned

100171

for the breechboard