

veyed Aflo
=Cell.DBo

Steel Screw Steam Trawler "HELIGAN"; Messrs. Cochrane & Sons
No. 589, building to class 100A1 "Steam Trawler".

Equipment Number - 4035.

The Hull Surveyors now report that the anchors
and chain cable supplied to this vessel are as follows:-

	Supplied				Rule		
	cwts	qrs	lbs		cwts	qrs	lbs
1st anchor	6	0	0 (stockless)	6	1	0 (stockless)	
	(3	2	8 (weight of cast steel head)	3	3	0 (wt. of c.s.head)	
2nd anchor	4	2	4 (ex stock)	4	2	0	
3rd anchor	2	2	8 (ex stock)	2	2	0	
total wt.	13	0	12	Collective wt.	13	1	0

89 1/3rd fathoms of 1" stud link chain
weight 46 cwts 2 qrs 1 lb.

90 f. of 1" cable
weight 45 cwts 3qrs 17 lbs


The first anchor is 28 lbs or 4% light, but the
second and third anchors are 4 & 8 lbs heavier ex stock than
required.

The chain cable supplied is 2qrs 12 lbs heavier
than required, although the length is 89 1/3rd fathoms instead
of 90 fathoms as required.

It is stated the Owners supplied the equipment of
anchors and cable, and are willing to accept the same, if approved
by the Committee.

It is submitted for the consideration of the
Committee whether the chain cable supplied might not be approved,
and the Surveyors informed that the first anchor (stockless)
must be replaced by one of not less weight than required by the
Rules.

Handwritten initials: B.S., C.F., and a signature.

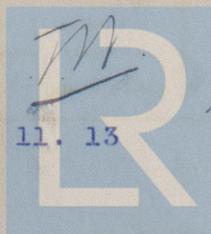

Handwritten date: 2020

Vertical handwritten number: 877-0038

NOV. 4 - 1913

4. 11. 13

Lloyd's Register
Foundation
Dr. 1. 11. 13.
And. 4.

Character