

HP. The SALVAGE ASSOCIATION have received the following


telegram from their Surveyor

dated Beyoglu
23rd Feb. 1934.

re "MAZORCA"

Surveyed afloat. Satisfied defects reported exist. Vessel shows no signs heavy weather experience. Side plating way of tanks many defective and repaired rivets of old standing. Tanks internal riveting stringers brackets lower bulkheads very poor condition, examination difficult due water and partly closed spaces, defects wear and tear of old standing.

Machinery clutches main bearings old standing seating riveting old standing. Consider defective riveting due constructional weakness owing old age and not heavy weather. Ship already had compensating girders fitted on tweendeck for stiffening purposes.

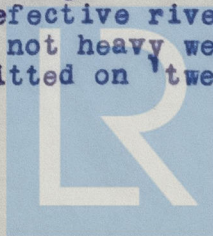

Lloyd's Register
Foundation

577a