

William Doxford &amp; Sons Ltd., Sunderland.

Yard No. 702.

5c,7,42 Sister vessel to the "HARLESDEN", "ENGLISH PRINCE" &amp; "TREVELYAN".

F.E.  
(FBD)

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

VESSEL'S NAME m.v. "EMPIRE CHEER"

REPORT

Sld.

33747

Nwc.

No. 101318

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

D to W dk. 38.07' D to 2nd dk 29' D for scantlings 37' (i.e. 8' above 2nd dk).

1st Long No. 15569

Depth "d" -

2nd Long No. 39222

Proportions =  $\frac{L}{D}$  11.05

Framing Bulb angle framing as approved Sheerstrake

The scantlings have been approved for a draught of 18" in excess of that corresponding to the freeboard which could be assigned as a C.S.S. vessel.

The tank top plating has been increased in thickness under the hatchways in lieu of ceiling.

This vessel appears to have been built in accordance with the Rules and the approved plans, and it is submitted she is eligible to be classed \*100A1 "With freeboard"

The Summer Freeboard as shown on the attached extract from the Freeboard Verification Form, now marked on the vessel's sides, to be inserted in the classification certificate and recorded in the Register Book, and further, the remaining freeboards, as shown on the accompanying extract, to be inserted in the certificate of classification.

2 Dks

Cell DB 356' 1161t, MT 29' 1205t, wing tanks in machy space 576t, 'tween deck tanks in machy space 444t, FPT 134t, APT 170t

FK, 7BH (Coll to W dk, 6 to 2nd dk); 6 divisional WT BHs in 'tween dks., pt Cem., Lloyd's A &amp; CP

O.L. 442.9'

E.S.D.


a

The class is assigned and maintained upon the understanding that the equipment will be made to accord with the requirements of the Rules when the present state of emergency has passed, and that hatch covers at the 2nd deck and cargo battens will be fitted at the first available opportunity.

Insert in S.R.L:- (A bower anchor and 45 fathoms of chain cable to be supplied). Hatch covers at the 2nd deck and cargo battens to be fitted at the first opportunity.



Stab. Job.

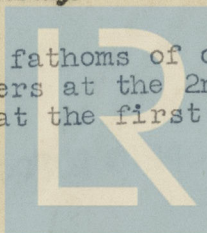

© 2020

Lloyd's Register  
FoundationJ.C.D.  
29.7.43

003181-003140-0251