

Register Tonnage

5118.26

1st Longitudinal Number (L x D)

15725

Managers R. Chapman

Short Brothers Ltd., Sunderland.

Yard No.485.

5c.11.44

Similar to the "EMPIRE MAURITIUS", "EMPIRE RABAU", "EMPIRE TAKORADI"

F.E.

(FBD.)

& "EMPIRE NAIROBI".

Received by Chief Ship Surveyor

Received from Chief Ship Surveyor

VESSEL'S NAME s.s. "EMPIRE DOMINICA"

REPORT Sld.

No. 34278

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

(The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement.—Extract from Sub-Committee's Report, 24/5/92.)

D to W dk 38' (flat sheer). D to 2nd dk 27.25' (flat sheer). D for scantlings 37'

1st Long. No. 15725

Depth "d" 21.83

2nd Long. No. 39525

Proportions = L/D 11.18

Framing As approved

Sheerstrake As approved

The scantlings of this "C" Type Standard Ship have been approved for a draught of 30" in excess of that corresponding to the freeboard which could be assigned as a C.S.S. vessel having a tonnage opening.

The tank top plating has been increased in thickness under the hatchways in lieu of ceiling.

This vessel appears to have been built in accordance with the Rules and the approved plans, and it is submitted she is eligible to be classed 100A1 "With freeboard"

The Summer Freeboard as shown on the attached extract from the Freeboard Verification Form, now marked on the vessel's sides, to be inserted in the classification certificate and recorded in the Register Book, and further, the remaining freeboards, as shown on the accompanying extract, to be inserted in the certificate of classification.

2 Dks "Butts of keel plating elec. welded" "Longitudinal framing at decks" Cell DB 317' 1283t, tank in way of tunnel 320t, wing tanks in mchy space 330t, fwd 280t, FPT 191t, APT 155t

FK, 7 BH, pt. Cem., Lloyd's A & CP

F 38'

O.L. 447.8'


E.S.D.

a+
2"

The class is assigned and maintained upon the understanding that the equipment will be made to accord with the requirements of the Rules when the present state of emergency has passed, and that hatch covers at the 2nd deck at Nos 1 & 6 hatchways and where omitted at No 3 hatchway and cargo battens will be fitted at the first available opportunity.

Insert in S.R.L.:-

(A bower anchor to be supplied). Hatch covers at the 2nd deck at Nos.1 & 6 hatchways and where omitted at No.3 hatchway and cargo battens to be fitted at the first opportunity.

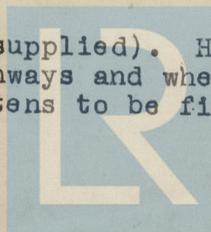

Lloyd's Register
Fundation

004489.004495-0138

12.9.45.

Thickness of intercostal plate

Angles

Poop Deck, Angle, [] or []