

EA

Ship's name "SALAMMANNA"

Port

22 JUL 1963
MDB. No. 22824

Last survey date 11.6.63

Class is subject to

indented shell plate in way of No.4 hold (s s) and structure in way and to indented sheerstrake and plating inlst below in way of No.3 hold (s.s),also to indented shell plate in 'A' strake in way of No.6 D.B. tank (s.s) and keel plates aft being specially examined and dealt with as necessary next drydocking.

S.R.L. Appendix (as before ~~on none~~)

Nature of present survey (afloat and ~~in drydock~~)

Temporary repairs to Nos.1 & 2 D.B. tanks.


Recommendation

SUBJECT as above and to No.1 D.B. tank in way of bilge (p.s) and to F.P. bulkhead (s.s) being specially examined and dealt with as necessary on arrival at Alexandria to which port she is proceeding via Bayonne, meantime No.1 D.B. tank not to be used until repairs effected.

As Now Subject

IN S.R.L. APPENDIX

Indents in side shell plating (p & s).
Poop side (p.s) indented.

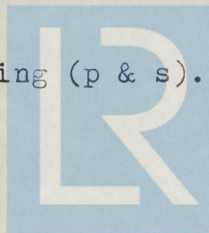

© 2021

Lloyd's Register
Foundation