

COPY.

Lloyd's Register of Shipping



Port Vancouver, B. C.

May 23rd, 1944.

This is to Certify that

S. F. BOOMER

the undersigned Surveyor to this Society did at the request of the Owners' Agents, King Bros., Victoria, B. C., attend on board the S.S. "CRYSTAL PARK", 7161 tons gross register of Montreal, for the purpose of ascertaining the nature and extent of damage stated sustained due to striking Assembly Wharf, Nanaimo, B. C., at time of departure on voyage to Victoria, B. C. on May 13th, 1944.

For further particulars see vessel's official Log Books.

Copy of extract from Note of Protest, dated 14th May, 1944, at Victoria, B. C. :-

"On May 13th, 1944, at 10.09 p.m. as the vessel was backing out from the Assembly Wharf, Nanaimo, the bracket of Starboard 'A' frame of paravane gear touched the wooden piling of the Wharf causing damage to the paravane bracket. Damage to the Wharf, if any, unknown."

Signed: L.C. Barry, Master.

On May 14th, 1944, while the vessel was lying afloat at Messrs. Victoria Machinery Depot Co. Ltd. Plant No. 2, Victoria, B. C., the undersigned upon examination, -

FOUND


Paravane "A" bracket, Starboard side, lower bracket support for shaft bearing distorted and broken away from shell plating where electric welded.

RECOMMENDED

Bearing bracket to be renewed. Surface fracture to be veed out and built up by electric welding.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, fault or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

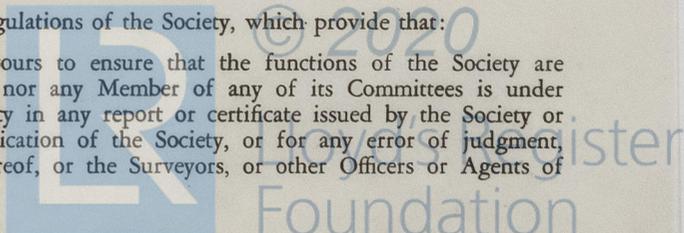

S.S. "CRYSTAL PARK"


FOUND

RECOMMENDED

Small surface fracture in shell plate at edge of welding in way of same.

The repairs as recommended were carried out by the Victoria Machinery Depot Co. Ltd., Victoria, B. C., and satisfactorily completed about 4.00 p.m., 14th May, 1944, and the vessel proceeded on her intended voyage.

A report has been forwarded to the Committee of Lloyd's Register of Shipping, London, stating that all the repairs have been satisfactorily carried out and recommending that the vessel be continued as previously classed.


S. B. Hoover
SURVEYOR TO LLOYD'S REGISTER.



© 2020

Lloyd's Register
Foundation

2/2 7720-709800-665800