


COPY.

# Lloyd's Register of Shipping.

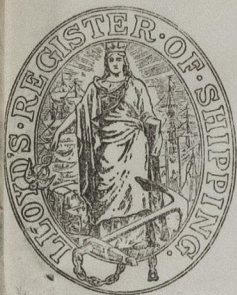

Port Aruba, N.W.I.

28th February, 1945

**This is to Certify** that

J.R. Pethers

the undersigned Surveyor to this Society did at the request of  
the Owners Representative attend on board the twin screw steamer  
"SURINAM"

3046 tons gross of Maracaibo, for the purpose of ascertaining the  
nature and extent of the damage stated to have been caused by  
grounding off Beacon T 19, Lake Maracaibo on 17th January, 1945  
from 3.45 p.m. to 6.10 p.m. on voyage from Aruba to Maracaibo, in  
ballast.

For further details please see Ship's Log Book and Note of Protest.  
On examining the vessel whilst on the Marine Railway, San Nicholas,  
Aruba, N.W.I., on 10th February, 1945, the undersigned

Found

Port tail shaft worn down 5/16" full.

Starboard tail shaft worn down 5/32.

Liners on port tail shaft in good  
condition.

Wood in both stern tube bushes worn.

Recommended

Port tail shaft to be drawn.

Both stern tube bushes to  
be rewooded.

Further recommended that all removals be replaced and where damaged  
in the course of the above repairs, repaired or renewed as necessary.

These recommendations made so as to place the vessel in the same  
good and efficient condition as before the damage was sustained.

The above repairs have now been completed to my satisfaction.

*Jas B Lutus*  
Surveyor to Lloyd's Register  
of Shipping.

Fee and expenses:- Fla. 53.00

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly  
executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances  
to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in  
entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of  
of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."