

Ship's name ⁸⁵: "LEONIDAS CAMBANIS"

Hamburg. (GAPB) # 1296, 13/8/63.
Port ⁸⁵: BAs. (GAPB) No. 35544

Class is subject to None.

Last survey date 20/9/63.

ES (due 6/64) not commenced (24/6/63).
MBS. (due 11/62) not held, Docking, Repairs (Hull Damage).
T802. (due 6/63)



M.E. L.P. stuffing - box, main condenser water box and main casing all repaired by Metalock & Hamburg Surveyor recommended that the main engine L.P. cylinder stuffing - box, main condenser water box and main circulating pump casing (Metalock 8/63) be examined by 1/64 (6 months limit).


A number of pump ends, valves and covers (cracked) renewed and repaired.

Propeller & O.T. stated damaged by wire-rope and BAs. Surveyor recommends that the propeller and outside fastenings be specially examined at next drydocking.

13 NOV 1963

It is submitted that the vessel **WILL BE** eligible for the record MBS. 8/63, T802. 7/63 Nov & ES (with date) when the survey has been completed, as per Form 10E, Subject as now recommended.

WD. (3.2 $\frac{1}{16}$ in.) renewed & nos 100%.

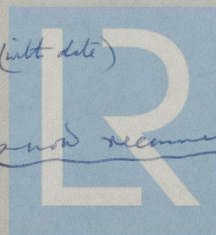

© 2020

Lloyd's Register Foundation

011995-012002-0121