

COPY

# LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

PORT Newcastle N.S.W.

3rd June, 1955.

This is to certify that

W.B.C. Elder

the undersigned Surveyor to this Society did at the request of  
The Owners

attend on board the Steel Bore Steamer "LADY ISOBEL" of Melbourne, 1545 Gross Registered Tons, on the 1st June 1955, and subsequently for the purpose of examining the vessel for damage, if any stated to have been sustained in consequence of foundering off Cape Edgecumbe on the 24th May, 1955, whilst on a voyage from Mourilyan Harbour to Melbourne, via Newcastle N.S.W.

For further particulars see Log Book and The Master's Accident Report to the Owner, from which it would appear the vessel grounded during heavy rain squalls at 7.45 a.m. was refloated at 7.53 a.m., using her own main engines and proceeded on her voyage.

Upon examination, vessel afloat and fully loaded at Newcastle N.S.W. on the 1st June 1955, the undersigned:-

Found:- From entries in the Soundings Book of soundings of tanks and bilges, taken from the time of the accident until her arrival at this port, and soundings taken on the 1st and 2nd June 1955, that the vessel made no water and is apparently not damaged as a result of the aforesaid accident, but it is recommended that her bottom plating etc. be specially examined on the occasion of her next dry docking.

Sgd. W.B.C. Elder


SURVEYOR TO LLOYD'S REGISTER

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-

"While the Committees of the Society use their best efforts to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

(RPT. 10)-5M-5/54-J. & O'S. (PRINTED IN AUSTRALIA)

© 2021

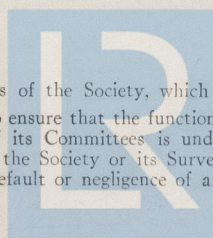

Lloyd's Register  
Foundation

012019-012026-0137