

Echevarreta Larraga Yard No 27

15 DEC 1933

M.S. "CAMPERO"

Air Receivers - See Endt. 19/10/33.


-----

The injection air receivers are to be worked at a pressure of 75 kgs. per sq.cm. and the Rules require that the hydraulic test should be 150 kgs. When the air receivers were ordered, however, the test pressure specified was 140 kgs. and this pressure has been applied by the Manufacturers and was duly witnessed by the Surveyor.

It is found from the tensile strength and thickness of the material that the air receivers are in accordance with the Rules for a working pressure considerably higher than that intended and in these circumstances it is submitted that the receivers be accepted without re-testing and that the Paris and Bilbao Surveyors be advised accordingly.

With reference to the Paris Surveyor's letter of the 30th ultime in which he states that Messrs. Brunon Vallette & Co. are prepared to carry out the Society's requirements for the manufacture of air receivers in future although they would prefer to work to the French Navy Specification, it is submitted the Surveyors be requested to arrange for the Society's requirements to be carried out in all cases.

15. 12. 33.

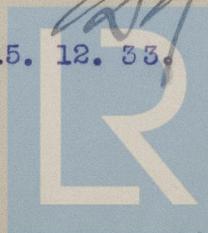

©2021

Lloyd's Register  
Foundation

013671-013677-0065