

JUN 1932 Rpt. 11b.

2116

Verification Report

WFO. 22 MARI 1911 No. 24768

Lloyd's Register of British & Foreign Shipping.

SURVEYS FOR FREEBOARD.—STEAM SHIPS.

21516

PARTICULARS RELATING TO ALL STEAM SHIPS EITHER FLUSH DECKED, OR WITH TOP GALLANT FORECASTLES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR WITH TOP GALLANT FORECASTLES HAVING LONG POOPS, OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey *Penderland*
Date of Survey *20/3/11*
Name of Surveyor *J. Allan*

Raised Quarter Deck.

Ship's Name. "RIDMORE"	Port of Registry and Nationality. <i>Shydeport</i>	Official Number. <i>132058</i>	Gross Tonnage. <i>968</i>	Date of Build. <i>1911</i>	Particulars of Classification. <i>+100 A1</i> <i>Contemplated</i>
Number in Register Book <i>11</i>	Name of Shipowner <i>A. P. Austin & Sons</i>		No. of Survey <i>257</i>		

Registered dimensions from Ship's Register.	LENGTH. <i>208.0</i>	BREADTH. <i>34.0</i>	DEPTH. <i>12.95</i>	UNDER DECK Tonnage. <i>729.83</i>
MEAN Frame Depth Rule	<i>208.0</i> <i>207.5</i>	<i>34.0</i>	<i>12.95</i>	<i>729.83</i>
CEILING	<i>207.5</i>	<i>34.0</i>	<i>12.95</i>	<i>729.83</i>
CORRECTED DIMENSIONS.	<i>207.5</i>	<i>33.63</i>	<i>13.56</i>	<i>729.83</i>

Moulded Depth as measured..... *14.11"*

NOTE.— If the depth is measured when vessel is afloat, the details of measurement should be reported.

CORRECTION FOR LENGTH.

Length of Ship on Loadline.....	<i>207.5</i>
Length in Table	<i>179.0</i>
Difference	<i>28.5</i>
Correction for 10ft., Table A.	<i>1.0</i>
× Difference divided by 10	<i>2.85</i>
If 1/10ths length covered divide by 2	<i>1.42 + 1/2"</i>

Co-efficient of fineness *.77*

Any modification necessary [Para. 4 (a) to (e)*] *.02* *Call. D.T.B.*

Co-efficient as corrected *.75*

CORRECTION FOR IRON DECK.

Proportion covered, if less than 1/10ths length covered	<i>62%</i>
Thickness of usual wood deck, less stringer.....	<i>3</i>
3/2 - 48 3.02 7.07	<i>3</i>

Sheer at Stem... *60"*

at Sternpost... *27"*

Sheer at 1/3 of the length from Stem *3 1/2"*

Sternpost *15 1/2"*

Gradual mean Sheer *Allowed*

Standard mean Sheer (Table, Para. 18) *30.75*

Difference..... *13.72*

§ If limited as Para. 18 (f).....

CORRECTION FOR ROUND OF BEAM.

Breadth at Gunwale amidships.....	<i>32.10"</i>
Round of Beam.....	<i>8 1/4"</i>
Normal round	<i>8 1/4"</i>
Difference	<i>+ 2 =</i>
Proportion of Deck uncovered (Para. 19)	

Rise in Sheer from amidships [Para. 18 (e)]

At front of bridge house.....

At after end of forecastle

Fall in shear Para. 18 (d) } ÷ 2 =

Length uncovered Correction

Freeboard, Table A	<i>2.550</i>	<i>2.5 1/2"</i>
Correction for Sheer	<i>3.43</i>	<i>- 3 7/8"</i>
Correction for Length	<i>1.42</i>	<i>+ 1 1/2"</i>
Allowance for Deck Erections	<i>7.79</i>	<i>- 7 3/4"</i>
Correction for Round of Beam.....	<i>1.770</i>	<i>1.8 7/8"</i>
Correction for fall in Sheer (if any)		
Correction for Iron Deck (if required)	<i>2.07</i>	<i>- 2</i>
Additions for non-compliance with provisions of Para. 11 (d) and (e) †	<i>1.563</i>	<i>1.5 3/4"</i>
Other Corrections (if any).....		

ALLOWANCE FOR DECK ERECTIONS:—

Freeboard, Table C.....	<i>6.92</i>	<i>7"</i>
Correction for Length, if required (Para. 12, 13, and 14)		
Freeboard by Table A, corrected for sheer, and for length, if required (Para. 12, 13, and 14) }	<i>2.2 1/4</i>	
Difference	<i>1.7 1/4</i>	
Percentage as below.....	<i>43.25</i>	<i>42.7</i>
Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11) }	<i>8.78</i>	<i>+ 1/2"</i>
Allowance for Deck Erections	<i>7.79</i>	<i>- 7 3/4"</i>

Winter Freeboard	<i>1.563</i>	<i>1.5 3/4"</i>
Summer Freeboard	<i>1.382</i>	<i>1.3 3/4"</i>
Indian Summer Freeboard	<i>1.201</i>	<i>1.2 1/4"</i>
N. A. Winter Freeboard		

Correction necessary because clearside amidships, measured in accordance with the Statute, is not taken at the intersection of the wood or iron deck with side. *1 1/2"*

Forecastle.....	Length <i>22.0</i>	Length allowed <i>22.0</i>	Height <i>7.3"</i>
Bridge House	<i>9.6</i>	<i>9.5</i>	<i>7.3</i>
† Raised Qr. Dk.....	<i>97.6</i>	<i>97.05</i>	<i>3.8 3/4"</i>
Poop.....		<i>129.0</i>	
Total		<i>128.5</i>	<i>.618</i>
Length of Ship		<i>207.5</i>	<i>.6217</i>
Corresponding percentage (Para. 11, 12, 13, and 14) }	<i>42.7</i>	<i>43.25</i>	

Winter Freeboard from deck line	<i>1.563</i>	<i>1.5 3/4"</i>
Summer " " " "	<i>1.382</i>	<i>1.3 3/4"</i>
Indian Summer " " " "	<i>1.201</i>	<i>1.2 1/4"</i>
N. A. Winter, " " " "		

Amended Tables March 1906.

FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck:—

Fresh Water Line above centre of Disc	
Indian Summer Line " " "	
Winter Line below " "	
Winter North Atlantic Line " " "	

† If the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.

‡ In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R.Q.D. is to be taken from the level of the top of the amidship beam.

§ In flush-decked vessels the total standard mean sheer means the sheer measured at the stem and sternpost. In vessels having poops and forecastles it means the sheer measured at points distant one-eighth of the vessel's length from stem and sternpost.

† State dimensions of freeing port area on back of this form.

‡ The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft, should be reported.

002241-002248-0154

MARKING REPORT RECEIVED 27 MAR 1911

Lloyd's Register FOUNDATION

21578

Do all the Frames extend to the top height in the Poop? Raised Quarter Deck? *yes* Bridge House *yes* Forecastle? *yes*
 To what height do the Reverse Frames extend? *Bulb Angle framing*
 Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? *joined to bridge*
 Give particulars of the means for closing the openings in Bulkhead *no openings*
 Is the Poop or Raised Quarter Deck connected with the Bridge House? *yes* Has the Bridge House an efficient Bulkhead at the fore end? *yes*
 Give particulars of the means for closing the openings in Bulkhead *no openings*
 What is the thickness of the Bridge Front plating? *.30* and Coaming plate? *no coaming*
 Give scantlings and spacing of the Stiffeners *5 x 3 x .38 Angles spaced .30"*
 Are bracket plates fitted at each end of the Stiffeners? *yes* Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks? *yes*
 Has the Bridge House an efficient Iron Bulkhead at the after end? *yes*
 How are the openings closed? *no openings*
 Is the Forecastle at least as high as the main or top-gallant rail? *7:3'* Has the Forecastle an efficient Iron or Wood Bulk'd. at after end? *Iron*
 Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse? *by R.Q. Deck*
 If the openings are not so protected are the exposed parts of the Casings efficiently constructed?
 Give thickness of plating; scantlings and spacing of Stiffeners
 What is the height of the exposed Casings? *7:0"* Are suitable means provided for closing all openings in them in bad weather? *yes*
 Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:— *yes*


Position and Size.	No. 1. 35.8' x 20.10'		No. 2. 34.8' x 21.11'		No. 3. 28.3' x 21.3'		Ship.	Rule.	Ship.	Rule.
	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.				
COAMING.										
Height above top of DECK	.49'	.49'	.49'	.49'	.44'	.44'				
Thickness { Sides.....	.50	.50	.50	.50	.50	.50				
{ Ends.....	.40	.40	.40	.40	.40	.40				
BEAMS										
Number.....	3 webs	3 webs	3 webs	3 webs	3 webs 38" deep.	3 webs (43" at aft)				
Section and Scantlings.....	4 beam	4 beam	4 beam	4 beam	4 beams 9" "	4 beams				
Material.....	Steel	Steel	Steel	Steel	Remainder of scantlings as per sketches					
FORE AND AFTERS.										
Number.....	No fore + after									
Section and Scantlings.....										
Material.....										
HATCHES Thickness.....	3"	3"	3"	3"	3"	3"				
Remarks.....										

* When the Fore and Afters are of wood the depth should be stated from the underside of the hatches.
 (If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.
 What is the thickness of the Bridge Sheerstrake? *.30* Strake between Main and Bridge Sheerstrakes? *.30*

Delete the words { The Crew are, ~~not~~, berthed in the bridge house.
 that do not apply { The arrangements to enable them to get backwards and forwards from their quarters are, ~~not~~ satisfactory.

Length of Bulwarks in well *78:10"*
 Area of Freeing Ports required by Para. 11 (e) each side of vessel = *15.76* Sq. ft.
 Ft. Tenths. Ft. Tenths. No. } Freeing Ports = *16.85* Sq. ft.
 2.83 x 1.75 x 3 } (each side of vessel)
 2.00 x 1.00 x 1 }
 Total deficiency or excess = *1.09* Sq. ft.

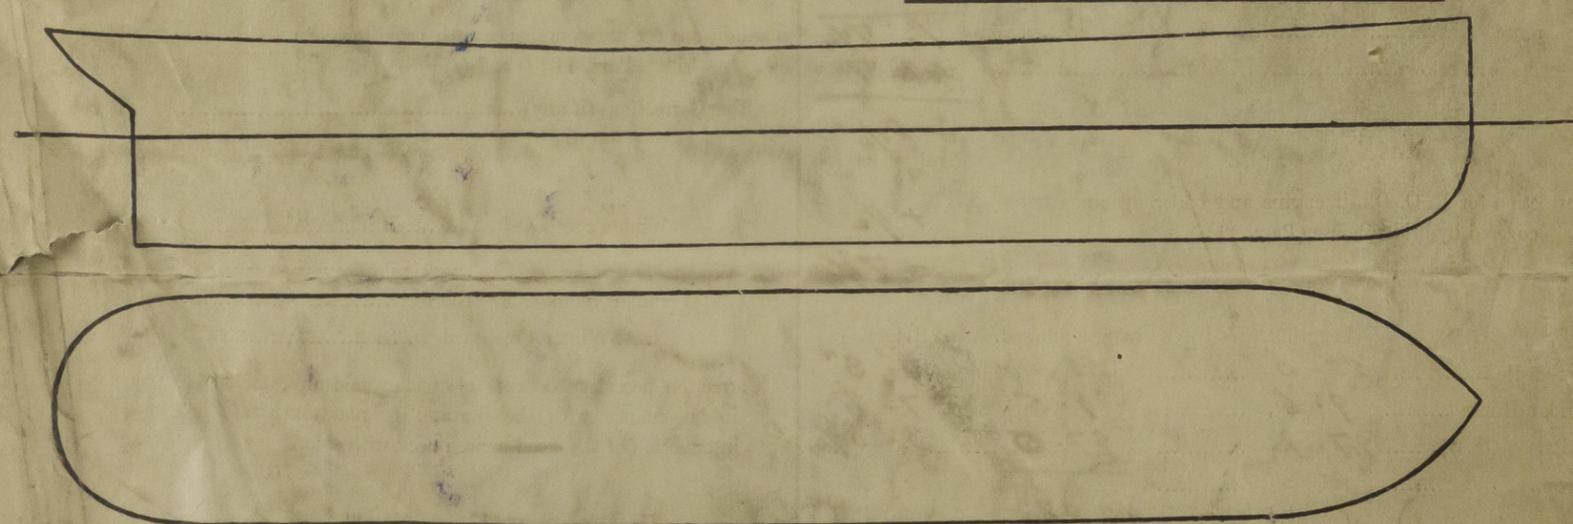

Show hereon line of Floors or Tank Top with position of any Breaks in same; also height of Peak Tank tops, &c., &c.

State any special features in the construction of the Vessel *There are no special features.*

See S.M. Report No 24526

The approved plans are forwarded for reference.

Owners
 Address
 Rec £

Received by me

