

TUE. 17 JUL. 1923

Index No. 30963  
(For London Office only.)

No. 28618

# Lloyd's Register of Shipping.

## SURVEYS FOR FREEBOARD.—STEAM SHIPS.

PARTICULARS RELATING TO ALL STEAM SHIPS EITHER FLUSH DECKED, OR WITH TOP GALLANT FORECASTLES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR WITH TOP GALLANT FORECASTLES HAVING LONG POOPS, OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey Sunderland  
Date of Survey 16<sup>th</sup> July 1923  
Name of Surveyor W. T. Hudson

BUILDER'S Name  
Messrs J. L. Thompson & Son Ltd  
ESTIMATE No. 5298  
Number in Register Book

Port of Registry and Nationality.

Official Number.

Gross Tonnage.

Date of Build.

Particulars of Classification.

100-A-1 (Contemplated)

Registered dimensions from Ship's Register.	LENGTH.	BREADTH.	DEPTH.	UNDER DECK TONNAGE.
	268.0	34.92	18.16	1532
Length on LOADLINE.	268.0	MEAN Frame Depth $\frac{9}{16}$ Rule $\frac{5}{16}$	Ceiling $\frac{1}{2}$ Peak $\frac{1}{2}$ Tanks $\frac{1}{2}$ Sheer $\frac{1}{2}$ Tanks $\frac{1}{2}$	INCL. ORDINARY FLIMS DECK TANK - 3
CORRECTED DIMENSIONS.	268.0	34.5	19.33	1529

Moulded Depth as measured.....20'-3"

Addition for Keel below base line for draught record.....134 inches.

NOTE.—If the depth is measured when vessel is afloat, the details of measurement should be reported.

## CORRECTION FOR LENGTH.

Length of Ship on Loadline.....268  
Length in Table.....248  
Difference.....20  
Correction for 10ft., Table A.....1.2  
× Difference divided by 10.....2.00  
If  $\frac{1}{10}$ ths length covered divide by 2.....1.50  
Table C. (if required.)  
+ 1 1/2

## CORRECTION FOR IRON DECK.

Proportion covered, if less than  $\frac{1}{10}$ ths length covered.....668  
Thickness of usual wood deck, less stringer.....22-4 3/4 = 3.05  
- 3

## CORRECTION FOR ROUND OF BEAM.

Breadth at Gunwale amidships.....26-8  
Round of Beam.....9-5  
Normal round.....9-16  
Difference.....34  
÷ 2 = 17  
Proportion of Deck uncovered (Para. 19).....37

NOTE.—The round of beam should be reported on the full breadth of vessel at the gunwale.

Co-efficient of fineness......787  
Any modification necessary [Para. 4 (a) to (e)]\* - .02 CELL 0.3  
Co-efficient as corrected......77

Sheer { Stem.....96 } 144 ÷ 2 = 72' ...Mean 36/35.02  
at { Sternpost.....48 }  
Sheer at  $\frac{1}{2}$  of the length from { Stem 53 } 49 ÷ 2 = 24.5 Mean  
Sternpost 26 } 41.82 ÷ .55 = 76.14  
Gradual mean Sheer.....41.82  
Standard mean Sheer [Table, Para. 18].....36.80  
Difference.....35.02  
÷ 4 = 8.75  
§ If limited as Para. 18 (f).....-8 3/4

Rise in Sheer { At front of bridge house.....  
from amidships { At after end of forecastle.....

Fall in Sheer { Para. 18 (d) } ÷ 2 =  
Length uncovered.....

Correction

## ALLOWANCE FOR DECK ERECTIONS:—

Freeboard, Table C.....1-5  
Correction for Length, if required (Para. 12, 13, and 14).....  
Freeboard by Table A, corrected for sheer, and for length, if required (Para. 12, 13, and 14).....3-2 3/4  
Difference.....1-9 3/4  
Percentage as below.....44.8%  
9.74

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11).....

Allowance for Deck Erections.....-9 3/4  
Length. Length allowed. Height.  
Castle.....22.32.....22.32.....7.0  
Bridge House.....50.75.....50.75.....7.0  
Raised Qr. Dk.....84.60 × 3.75 ÷ 4.23.....75.00.....7.45  
.....21.43.....21.43.....7.5  
Total.....179.10 = .668.....169.50 = .632  
Length of Ship.....268

Proportioning percentage { Para. 11, 12, 13, or 14 } 44.8%

FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck:—  
Fresh Water Line above centre of Disc.....  
Indian Summer Line " " " ".....  
Winter Line below " " " ".....  
Winter North Atlantic Line " " " ".....

Winter Freeboard.....2-3 1/2  
Summer Freeboard (22-32) 3/4 2-0 1/4  
Indian Summer Freeboard.....1-9 3/4  
N. A. Winter Freeboard.....3 8 7-6 1/2 2-6 1/2

Correction necessary because clearside amidships, measured in accordance with the Statute is not taken at the intersection of the wood (iron) deck with side. + 1 1/2

Winter Freeboard from deck line.....2-5  
Summer " " " ".....2-2 13/4  
Indian Summer " " " ".....1-4 10/12  
N. A. Winter " " " ".....2-2 8

+ State dimensions of freeing port area on back of this form.

The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft, should be reported.

© 2020

Lloyd's Register Foundation

002410-002417-0106



Do all the Frames extend to the top height in the Poop? \_\_\_\_\_ Raised Quarter Deck? \_\_\_\_\_ Bridge House? \_\_\_\_\_ Forecastle? \_\_\_\_\_

To what height do the Reverse Frames extend? \_\_\_\_\_

Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? \_\_\_\_\_

Give particulars of the means for closing the openings in Bulkhead \_\_\_\_\_

Is the Poop or Raised Quarter Deck connected with the Bridge House? \_\_\_\_\_ Has the Bridge House an efficient Bulkhead at the fore end? \_\_\_\_\_

Give particulars of the means for closing the openings in Bulkhead \_\_\_\_\_

What is the thickness of the Bridge Front plating? \_\_\_\_\_ and Coaming plate? \_\_\_\_\_

Give scantlings and spacing of the Stiffeners \_\_\_\_\_

Are bracket plates fitted at each end of the Stiffeners? \_\_\_\_\_ Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks? \_\_\_\_\_

Has the Bridge House an efficient Iron Bulkhead at the after end? \_\_\_\_\_

How are the openings closed? \_\_\_\_\_

Is the Forecastle at least as high as the main or top-gallant rail? \_\_\_\_\_ Has the Forecastle an efficient Iron or Wood Bulk'd. at after end? \_\_\_\_\_

Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse? \_\_\_\_\_

If the openings are not so protected are the exposed parts of the Casings efficiently constructed? \_\_\_\_\_

Give thickness of plating; scantlings and spacing of Stiffeners \_\_\_\_\_

What is the height of the exposed Casings? \_\_\_\_\_ Are suitable means provided for closing all openings in them in bad weather? \_\_\_\_\_

Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:—

Position and Size.		Ship.		Rule.		Ship.		Rule.		Ship.		Rule.		Ship.		Rule.	
Item.		Ship.		Rule.		Ship.		Rule.		Ship.		Rule.		Ship.		Rule.	
COAMING.	Height above top of DECK																
	Thickness { Sides.....																
	Ends.....																
SHIFTING BEAMS OR WEB PLATES.	Number .....																
	Section and Scantlings .....																
	Material .....																
* FORE AND AFTERS.	Number .....																
	Section and Scantlings .....																
	Material .....																
HATCHES Thickness .....																	
Remarks.....																	

\* The depth of Fore and Afters should be stated from the underside of the hatches in all cases.

(If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter-Deck Rules.

What is the thickness of the Bridge Sheerstrake? \_\_\_\_\_ Strake between Main and Bridge Sheerstrakes? \_\_\_\_\_

Delete the words { The Crew are, are not, berthed in the bridge house.  
that do not apply { The arrangements to enable them to get backwards and forwards from their quarters are, are not satisfactory.

Length of Bulwarks in well \_\_\_\_\_


Area of Freeing Ports required by Para. 11 (e) each side of vessel = \_\_\_\_\_ Sq. ft.

Ft. Tenths. Ft. Tenths. No.

× ×  
× ×

Freeing Ports  
(each side of vessel) = \_\_\_\_\_ Sq. ft.

Total deficiency or excess = \_\_\_\_\_ Sq. ft.

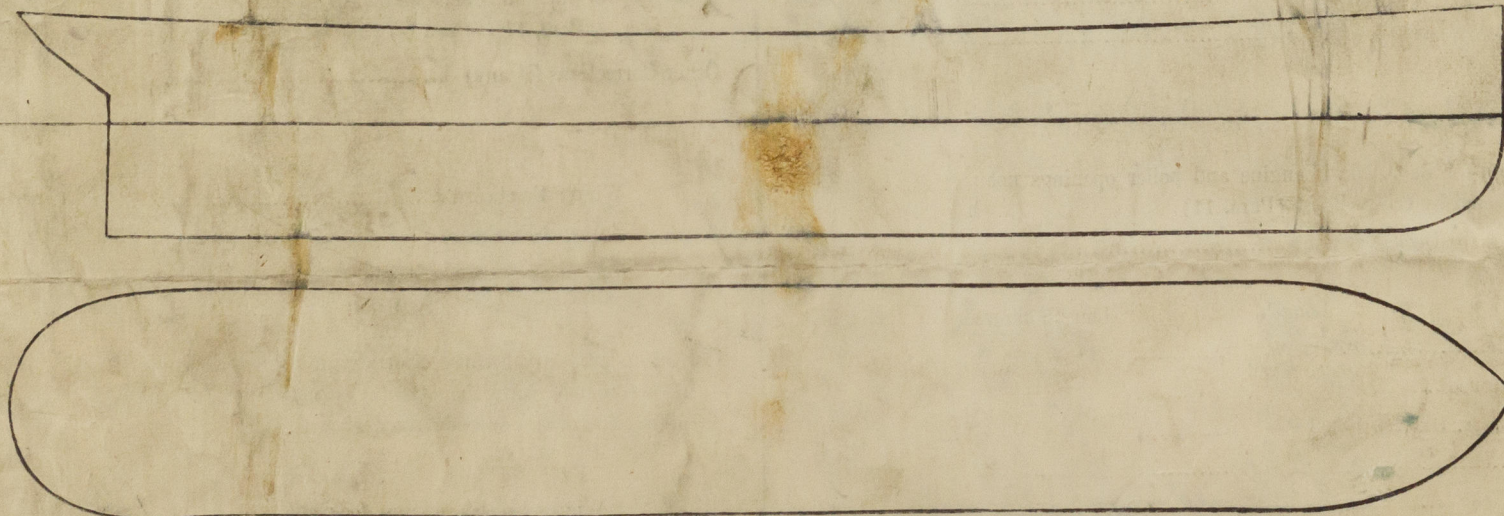

Show hereon line of Floors or Tank Top with position of any Breaks in same; also height of Peak Tank tops, &c., &c.

State any special features in the construction of the Vessel \_\_\_\_\_

Builder's name and yard number \_\_\_\_\_

Names of sister vessels \_\_\_\_\_

Owners \_\_\_\_\_


Address \_\_\_\_\_

Fee £ \_\_\_\_\_

To be charged on completion

Received by me

See F.C. Report

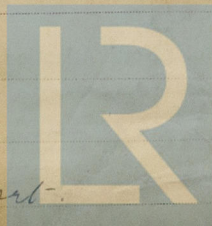

© 2020

Lloyd's Register  
Foundation