

"JACQUES-MARIE"

Ant. 24864.

Before this case receives consideration IT IS SUBMITTED the Antwerp Surveyors be informed that the plan of boiler shows a heating surface of 144.7 m² per boiler, which does not correspond with the reported figure, neither is there any statement as to the superheater heating surface per boiler, and their comments are desired.

They should also be asked to state the diameter of each main safety valve since the figure reported is considerably below Rule requirements.

In addition they should be asked to confirm/ that the following branch bilge suction have been fitted:-

Engine Room

Three at 2½" diameter

One at 3" diameter

Two at 70 m.m. (Engine Room Well Aft)

Tunnel

One at 2½" diameter

Forward Hold

Two at (size required)

Aft Hold

Four at (size required)

since these details are missing from the First Entry report./ They should be requested to quote the bilge suction in this general manner in all future cases.


Ent.

See Ant. h. 7
20/9/48.

Note Ant. J 9/9

9. 9. 48.

© 2020

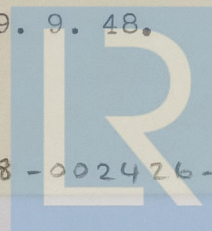

Lloyd's Register
Foundation

002418-002426-0124