

LLOYD'S REGISTER OF SHIPPING



Port C A R D I F F.

17th May, 1957.

This is to Certify that I have
 Port Donkey part of the
 Surveyed the Boiler and Machinery of the m.v. "ASTURIA" 10,000
 tons gross of Kragero, whilst in dry dock and afloat at Cardiff,
 on the 15th April, 1957 and subsequently for damage stated to
 have been sustained due to fire occurring in stokehold on the
 14.4.57., Advancement of CS. and DBS.,
 and that I have transmitted to the Committee of Lloyd's
 Register of Shipping, London, a Report stating that all
 recommendations made by me in connection therewith have
 been carried out to my satisfaction, and that I have
 Recommended that the record of DBS (Donkey Boiler Survey)
 1-57 as previously recommended and with fresh record of CS
 (Continuous Survey of Engines) with date
 be made in the Register Book in the case of this vessel when
 the survey has been completed, subject as previously to No. 6
 M.E. cylinder cover being re-examined by the end of January,
 1958 (12 months' limit) & subject amendment
 (now) to tie bolt between Nos. 2 & 3 M.E.
 cylinders (p.s.) being re-examined and dealt
 with as necessary by the end of May, 1958
 (12 months' limit).

Parts now examined:-


Parts now examined:-

Propeller, outside fastenings and sea connections.
 Main Engine:- Valves & gears, No. 1 crankpin bearing & webs &
 Nos. 1, 5 & 6 Main bearings. Thrust block shaft & bearings &
 holding down bolts, main engine tie bolts and holding down bolts.
 Auxiliaries:- Bilge pump, diesel oil transfer pump, sanitary pump,
 boiler fuel transfer pump and fan engine. Lubricating oil cooler,
 fuel valve diesel oil cooler, steering engine and windlass, Aux. condenser.
 Engine room & stokehold electric circuits & fire extinguishers.
 Port donkey boiler & port & starboard safety valves.

(H. B. BROWN)

H. B. Brown
 Engineer Surveyor to Lloyd's Register

This certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-
 The Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be
 understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any
 error in any report or certificate issued by the Society or its Surveyors, or any entry in the Register Book or other publication of the Society,
 or for any error of judgment, default or negligence of any Member thereof, or the Surveyors, or other Officers or Agents
 of the Society.

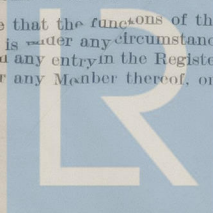

Lloyd's Register
 Foundation

002602-002610-0119