

VERIFICATION REPORT

Index No. **30222**
(For London Office only.)

Lloyd's Register of Shipping. SURVEYS FOR FREEBOARD.—STEAM SHIPS.

No. **28170**
FRI. 7 OCT. 1921

PARTICULARS RELATING TO ALL STEAM SHIPS EITHER FLUSH DECKED, OR WITH TOP GALLANT FORECASTLES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR WITH GALLANT FORECASTLES HAVING LONG POOPS, OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey **Sunderland**
Date of Survey **30th Sept 1921**
Name of Surveyor **A. Wickworth**

Ship's Name BRITISH CHANCELLOR MESSRS SIR JAMES LAING & CO No 681 Number in Register Book	Port of Registry and Nationality. LONDON U.K.	Official Number. 146197	Gross Tonnage. 7100 <i>7985.99</i>	Date of Build. 1921	Particulars of Classification. 100 A.1. Contemplated. Carrying petroleum in bulk.
---	---	-----------------------------------	---	-------------------------------	---

Registered dimensions from Ship's Register.	LENGTH.	BREADTH.	DEPTH.	UNDER DECK TONNAGE.
	440.3	54.10	34.00	6549.4
Length on LOADLINE.	439.4	Frame Depth $9\frac{1}{4}$ Rule " $7\frac{1}{4}$ <i>No Sparring + 33</i>	Ceiling $+20$ Sheer $+91$	Peak Tanks } incl ER tank 10 BR. " 34.6
CORRECTED DIMENSIONS.	439.40	54.086	34.11	6594

Moulded Depth as measured..... **33.11**

Addition for Keel below base line for draught record..... **2.2** inches.

NOTE.—If the depth is measured when vessel is afloat, the details of measurement should be reported.

Co-efficient of fineness..... **.75**
Any modification necessary [Para. 4 (a) to (e)]* } **Shkerwood type bilst**
Co-efficient as corrected **.75**

Sheer { Stem..... **108**
at { Sternpost **60** } $168 \div 2 = 84$ Mean **86.8**
53.94
36.32.86
Sheer at $\frac{1}{2}$ of the length from { Stem $61\frac{1}{4}$
Sternpost $33\frac{3}{4}$ } $95\frac{1}{2} \div 2 = 47.75$ Mean **85.4**
Gradual mean Sheer **85.4**
Standard mean Sheer [Table, Para. 18] **53.94** Correction
86.8 + 84 = 85.4 Difference..... **31.46** $\div 4 = 7.86$
§ If limited as Para. 18 (f) **Say - 7.4**

Rise in Sheer { At front of bridge house.....
from amidships {
[Para. 18 (e)] { At after end of forecastle.....

Fall in Sheer {
Para. 18 (d) { $\div 2 =$ **Nil**
Length uncovered Correction

ALLOWANCE FOR DECK ERECTIONS:—

Freeboard, Table C..... **5 - 11 $\frac{1}{4}$**
Correction for Length, if required (Para. 12, 13, and 14) **+ 2 $\frac{3}{4}$**
6 - 21 $\frac{1}{4}$
Freeboard by Table A, corrected for sheer, and for length, if required (Para. 12, 13, and 14) } **8 - 10 $\frac{3}{4}$**
Difference **2 - 8 $\frac{3}{4}$**
Percentage as below..... **28.15% of 82 $\frac{1}{4}$ 33"**
Say 9 $\frac{1}{4}$ "
9.29

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11)
Allowance for Deck Erections **- 9 $\frac{1}{4}$ "**

	Length.	Length allowed.	Height.
Forecastle.....	48' + 12'	49.00	8-0
Bridge House.....	32.4 + 12' overhang each end	33.58	8-0
† Raised Qr. Dk.....		113.12	8-0
Poop.....	113.12	195.707	
Total		439.40	= 445
Length of Ship			
Corresponding percentage { (Para. 11, 12, 13, or 14) }		28.15%	

FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck:—
Fresh Water Line above centre of Disc
Indian Summer Line " " "
Winter Line below " "
Winter North Atlantic Line " " "

CORRECTION FOR LENGTH.
Length of Ship on Loadline..... **439.4**
Length in Table **407.0**
Difference **32.4**
Correction for 10ft., Table A. **1.7** Table C. **.8**
 \times Difference divided by 10 **5.81.50** (if required.) **2.64.59**
If $\frac{1}{10}$ ths length covered divide by 2 **+ 5 $\frac{1}{2}$** **+ 2 $\frac{3}{4}$**

CORRECTION FOR IRON DECK.
Proportion covered, if less than $\frac{1}{10}$ ths length-covered **44.52**
Thickness of usual wood deck, less stringer **3 $\frac{1}{2}$** **- 1 $\frac{1}{2}$**

CORRECTION FOR ROUND OF BEAM.
Breadth at Gunwale amidships..... **55.10**
Round of Beam **14**
Normal round..... **14**
Difference $\div 2 =$
Proportion of Deck uncovered (Para. 19)

NOTE.—The round of beam should be reported on the full breadth of vessel at the gunwale.

Freeboard, Table A **9' 1"**
Correction for Sheer **- 7 $\frac{3}{4}$ "**
8 - 5 $\frac{1}{4}$ "
Correction for Length **+ 5 $\frac{1}{2}$ "**
8 - 10 $\frac{3}{4}$ "
Allowance for Deck Erections **- 9 $\frac{1}{4}$ "**
8 - 1 $\frac{1}{2}$ "
Correction for Round of Beam.....
Correction for fall in Sheer (if any).....
Correction for Iron Deck (if required) **- 1 $\frac{1}{2}$ "**
8' - 0"
Additions for non-compliance with provisions of {
Para. 11 (d) and (e) † }
Other Corrections (if any)

Winter Freeboard **8' - 0"**
Summer Freeboard **7' - 5 $\frac{3}{4}$ "**
Indian Summer Freeboard **6 - 11 $\frac{1}{2}$ "**
N. A. Winter Freeboard
Correction necessary because clearside amidships, measured in accordance with the Statute is not taken at the intersection of the wood or iron deck with side. **1 $\frac{3}{4}$ "**

Winter Freeboard from deck line **8 - 1 $\frac{3}{4}$ "**
Summer " " " **7 - 7 $\frac{1}{2}$ "**
Indian Summer " " " **7 - 1 $\frac{1}{4}$ "**
N. A. Winter " " " **7 - 7 $\frac{1}{2}$ "**
Steel " " " **7 $\frac{1}{2}$ "**
6 $\frac{3}{4}$ "
6

† If the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.
† In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R.Q.D. is to be taken from the level of the top of the amidship beam.
† In flush-decked vessels the total standard mean sheer means the sheer measured at the stem and sternpost. In vessels having poops and forecastles, it means the sheer measured at points distant one-eighth of the vessel's length from stem and sternpost.

† State dimensions of freeing port area on back of this form.
† The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft should be reported.

003065-003074-0225

Do all the Frames extend to the top height in the Poop? *Long for* Raised Quarter Deck? *yes* Bridge House? *yes* Forecastle? *yes*

To what height do the Reverse Frames extend? *Longitudinally framed*

Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? *yes*

Give particulars of the means for closing the openings in Bulkhead *weather boards fitted full height in riveted channels also rubber jointed plate*

Is the Poop or Raised Quarter Deck connected with the Bridge House? *NO* Has the Bridge House an efficient Bulkhead at the fore end? *yes*

Give particulars of the means for closing the openings in Bulkhead *One opening closed with mechan w.s. Door 5'-0" x 2'-9"*

What is the thickness of the Bridge Front plating? *40* and Coaming plate? *44*

Give scantlings and spacing of the Stiffeners *8 1/2 x 3 1/2 x 64 BA's Spaced 29" and 30"*

Are bracket plates fitted at each end of the Stiffeners? *yes* Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks? *yes*

Has the Bridge House an efficient Iron Bulkhead at the after end? *yes*

How are the openings closed? *Centre line opening 3'-0" wide closed with storm boards fitted full height in riveted channels. Port and starboard openings closed with mechan w.s. doors 5'-0" x 2'-9"*

Is the Forecastle at least as high as the main or top-gallant rail? *yes* Has the Forecastle an efficient Iron or Wood Bulk'd. at after end?

Are the Engine and Boiler openings covered by a ~~Raised~~ Poop, ~~Raised~~ Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse? *yes*

If the openings are not so protected are the exposed parts of the Casings efficiently constructed? *yes*

Give thickness of plating; scantlings and spacing of Stiffeners

What is the height of the exposed Casings? *8'-0"* Are suitable means provided for closing all openings in them in bad weather? *yes*

Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:— *yes*

Position and Size.		No 1 9'-0" x 12'-0"									
Item.		Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.
COAMING.	Height above top of DECK	30	24								
	Thickness Sides	44									
	Ends	44									
SHIFTING BEAMS OR WEB PLATES.	Number	1	1								
	Section and Scantlings	PLATE 13 x 10 x 30									
	Material	Steel	4 ANGLES 3 x 3 x 40								
* FORE AND AFTERS.	Number	no fore & afters									
	Section and Scantlings										
	Material										
HATCHES Thickness		2 1/2									
Remarks		Satisfactory									

* The depth of Fore and Afters should be stated from the underside of the hatches in all cases.

(If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.

What is the thickness of the Bridge Sheerstrake? *Strake between Main and Bridge Sheerstrakes?*

Delete the words *The Crew are, are not, berthed in the bridge house.*


that do not apply *The arrangements to enable them to get backwards and forwards from their quarters are, are not satisfactory.*

Length of Bulwarks in well

Area of Freeing Ports required by Para. 11 (e) each side of vessel = Sq. ft.

Ft. Tenths. Ft. Tenths. No. } Freeing Ports (each side of vessel) = Sq. ft.

Total deficiency or excess = Sq. ft.

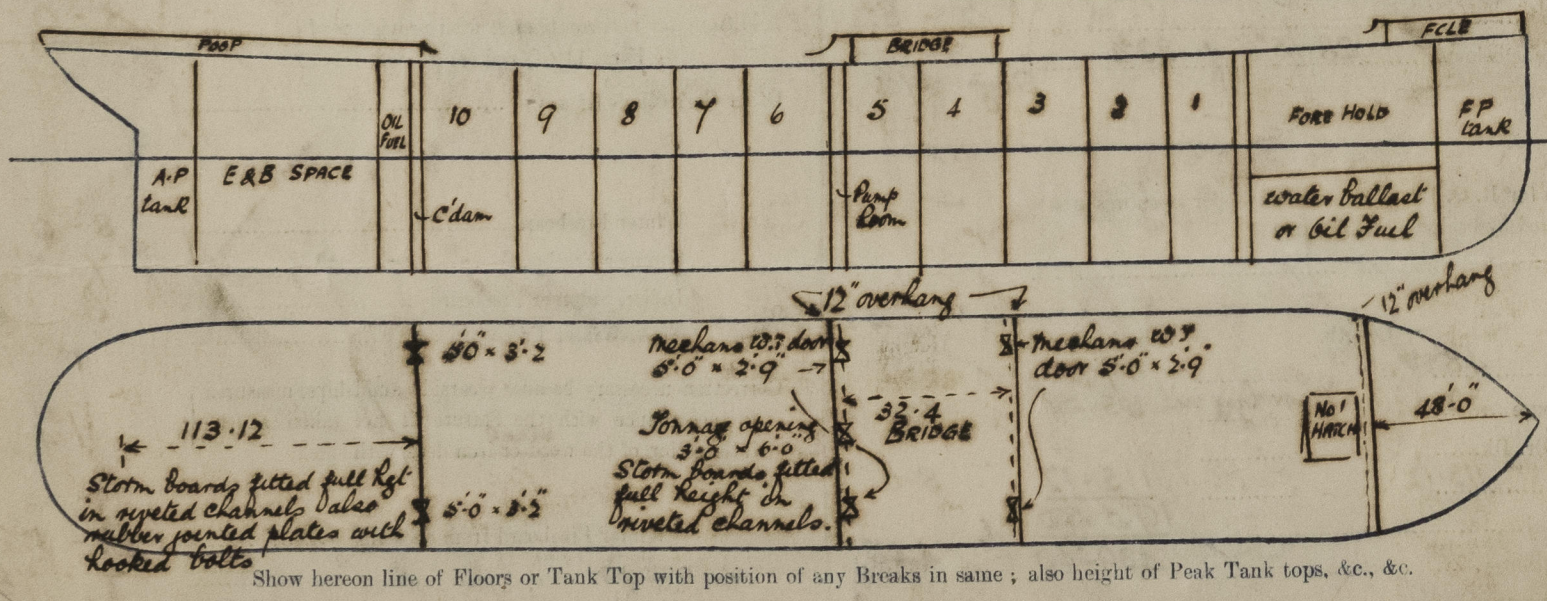

State any special features in the construction of the Vessel *This vessel is an Oiler (Shenwood Longitudinal framing and has been constructed in accordance with the approved plans and the Rules. She is a duplicate of S British Colonel Sld Rpt 28090. Request form Renewal*

Owners *The app'd midship section and profile are forwarded for register*