

REPORT ON ELECTRIC FITTINGS.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

10 MAY 1928

Date of writing Report

10

When handed in at Local Office

9 MAY 1928

Port of

NEWCASTLE-ON-TYNE & SUNDERLAND.

No. in Survey held at Sunderland.

Date, First Survey Mar 8 '28 Last Survey 20 Apr 1928

Reg. Book. Supp.

(Number of Visits.....)

40057 on the S.S. "Bactria"

Tons { Gross 2402
Net 1209

Built at Sunderland

By whom built J. L. Thompson & Sons Ltd

No. 561 When built 1928

Owners America Levant Line Ltd

Port belonging to London.

Electric Light Installation fitted by Sunderland Forge & Eng Co Ltd

Contract No.

When fitted 1928.

System of Distribution

Double wire

Pressure of supply for Lighting

110

volts, Heating

volts, Power

volts.

Direct or Alternating Current, Lighting

Direct

Power

If alternating current system, state frequency of periods per second

Has the Automatic Governor been tested and found efficient when the whole load is suddenly thrown on or off

Yes

Generators, do they comply with the requirements regarding rating

Yes

are they compound wound

Yes

are they over compounded 5 per cent.

Yes

if not compound wound state distance between each generator

Where more than one generator is fitted are they arranged to run in parallel

is an adjustable regulating resistance fitted in series with each shunt field

Are all terminals accessible, clearly marked, and furnished with sockets

Yes

short circuited, or touched

Yes

Are the lubricating arrangements of the generators as per Rule

Yes

Position of Generators

Engine room starboard side.

is the ventilation in way of the generators satisfactory

Yes

are they clear of all inflammable material

Yes

if situated near unprotected woodwork or other combustible material, state distance of same horizontally from or vertically above the generators

are the generators protected from mechanical injury and damage from water, steam or oil

Yes

are their axes of rotation fore and aft

Yes

Earthing, are the bedplates and frames of the generating plant efficiently earthed

Yes

are the prime movers and

their respective generators in metallic contact

Yes

Main Switch Boards, where placed

Engine room starboard side

If the generators and main switchboard are not placed in the same compartment, is each generator provided with a fuse on each insulated pole as near as possible to the terminals of the generator, additional to that provided on the main switchboard

Switchboards, are they placed in accessible positions, free from inflammable gases and acid fumes

Yes

are they protected from mechanical injury and damage from water, steam or oil

Yes

if situated near unprotected

woodwork or other combustible material, state distance of same horizontally from or vertically above the switchboards

are they constructed wholly of durable, non-ignitable non-absorbent materials

Yes

is all insulation of high dielectric strength and of

permanently high insulation resistance

Yes

if semi-insulating material is used, are all conducting parts insulated from the slab

with mica or micanile or other non-hygroscopic insulating material, and the slab similarly insulated from its framework

Yes

and is the frame effectively earthed

Yes

Are the fittings as per Rule regarding:— spacing or shielding of live parts

Yes

accessibility of all parts

Yes

absence of fuses on back of board

Yes

proportion of omnibus

bars

Yes

individual fuses to voltmeter, pilot or earth lamp

Yes

connections of switches

Yes.

Main Switchgear, description of switchgear for each generator and each outgoing circuit, and arrangement of equalizer switches

Double pole

switch fuses on main generator. Single pole switch & double pole fuses on each outgoing circuit.

Instruments on main switchboard

one

ammeters

one

voltmeters

synchronising device for paralleling purposes.

Earth Testing, state what means are provided at the main switchboard for indicating the state of the insulation of the system

Earth lamps


coupled to earth through switches & fuses

Switches, Circuit Breakers and Fusible Cut-outs, do these comply with the requirements of the Rules

Yes

Joint Boxes Section and Distribution Boards, is the construction, protection, insulation, material, and position of these as per rule

Yes.

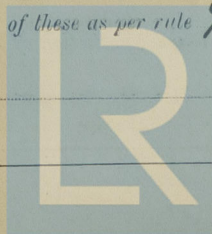

© 2020

Lloyd's Register
Foundation

All Conductors are of annealed copper conforming to British Standard Specification No. 7.

The Insulated Conductors are guaranteed to withstand the immersion and resistance tests specified in the Rules.

The foregoing is a correct description.

THE SUNDERLAND FORGE & ENGINEERING CO. LTD.

Electrical Engineers.

Date 23rd April 1928.

COMPASSES.

Distance between electric generators or motors and standard compass 72 feet.

Distance between electric generators or motors and steering compass 70 feet.

The nearest cables to the compasses are as follows:—

A cable carrying 6.32 Ampères 10 feet from standard compass 10 feet from steering compass.

A cable carrying .2 Ampères 10 feet from standard compass led into feet from steering compass.

A cable carrying .2 Ampères led into feet from standard compass 10 feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power Yes

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted Yes

The maximum deviation due to electric currents was found to be nil degrees on all course in the case of the standard compass, and nil degrees on all course in the case of the steering compass.

JOSEPH L. THOMPSON & SONS, LIMITED.

J. L. Thompson

Builder's Signature.

Date 25th Apr. 1928

Is this installation a duplicate of a previous case Yes. If so, state name of vessel Bosnia

General Remarks (State quality of workmanship, opinions as to class, &c.)

The above installation is in accordance with the Society's Rules. The vessel is eligible in my opinion for notation elec light wireless

It is submitted that
this vessel is eligible for
THE RECORD. Elec. light.

W. T. Badger
10/5/28

Total Capacity of Generators 10 Kilowatts.

The amount of Fee ... £ 10:

When applied for,
23rd Apr. 1928
When received,
25th Apr. 1928

Travelling Expenses (if any) £ :

W. T. Badger

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Assigned

Elec light



© 2020

Lloyd's Register
Foundation