

REPORT ON BOILERS.

No. 12042.

8 - OCT 1930

Writing Report 1 Oct. 1930 When handed in at Local Office

Port of Amsterdam

Survey held at Haarlem

Date, First Survey 10 Dec 1929

Last Survey 6 June 1930

on the M.V. "TARAKAN"

(Number of Visits 7)

Gross Tons

Net Tons

Built at Rotterdam By whom built M^r Eysenrood

When built 1930

made at Haarlem

By whom made N.V. Werf Hubertina

When made 1930

Shoemaker M^r Nederland

Port belonging to Amsterdam

VERTICAL DONKEY BOILER

No. One Description Vertical

Manufacturers of steel Schulz Knauth

at Haarlem By whom made N.V. Werf Hubertina When made 1930 Where fixed

Working pressure 5 kg

by hydraulic pressure to 142 Date of test 16-6-30 No. of Certificate 363 Fire grate area nil Description of safety valves spring loaded

safety valves 2 Area of each 3.90 Pressure to which they are adjusted If fitted with easing gear If steam from main boilers can

the donkey boiler Dia. of donkey boiler 2000 Length 4650 Material of shell plates SMS Thickness 11 mm Range of tensile

with 4/50 Descrip. of riveting long. seams Lap joint Dia. of rivet holes 22 mm Whether punched or drilled drilled Pitch of rivets 68 mm

of plating 106 Per centage of strength of joint Rivets 752 Working pressure of shell by rules 5.5 kg Thickness of shell crown plates 15 mm

of do. 1600 mm No. of Stays to do. Dia. of stays Diameter of furnace Top Bottom Length of furnace

ness of furnace plates 18 mm Description of joint no joint Working pressure of furnace by rules approved Thickness of furnace crown

18 mm Radius of do. 1600 mm Stayed by Diameter of uptake Thickness of uptake plates

ness of water tubes

The foregoing is a correct description,

N.V. WERF "HUBERTINA"
G. F. Bruggeman Manufacturer.

During progress of work in shops - - 17.22 April. 15.31 June May; 6 June
During erection on board vessel - - -
Total No. of visits

Retained in London
the approved plan of boiler forwarded herewith E 25-10-29

GENERAL REMARKS (State quality of workmanship, opinions as to class, &c.)

This Donkey Boiler has been made in accordance with the approved plan and Secretary's letter. Material tested as per rules. Workmanship throughout good.

A copy of this report has been forwarded to the Rotterdam office.

In General
box
Nederlandsche
SBC 202-4

Plan not available

Survey Fee ... 50:40 : When applied for, 19
Travelling Expenses (if any) 13:70 : When received, 3 9 1930

The fee has been already paid by Hubertina 3-9-30.


FRI. 16 JAN 1931

Committee's Minute

Assigned

See Rot. J.E. 19959

Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

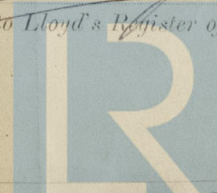

Lloyd's Register

003401-003408-0106