

N. N. DUNMORE

AMERICAN BUREAU OF SHIPPING

CERTIFICATE NO.

5.87



PORT OF

SOURABAYA.

DATE 10th December 1952.-

This is to Certify that A.C. van Bezuije, the Under-
signed Surveyor did attend on board the

ms. " N A S S A U "

8656 in Record 1952 whilst the ship was lying afloat and placed in
drydock on the 19th November 1952 and subsequently for the annual
survey and have to report as follows:

Vessel placed in drydock, bottom and rudders cleaned. Both rudders
removed, found in good condition, bushes renewed. Bottom plating
found indented over 6 frame spaces forward of aft. bulkhead hatch
No.2, internal structure in way examined and found good. It may be
agreed to effect repairs to the shellplating by next drydocking as
was requested by the Owners' Superintendent.

Coamings, covers, tarpaulins, supports and securing arrangement of
hatchways, ventilators, airpipes and their closings, superstructures,
doors and fastenings engine skylight, side scuttles, scuppers, guard,
rails and freeing ports, examined and found or made in order.
Poop side plating Port & Starb. in way of crew quarters found badly
corroded just above deck. Plating in way doubled.
Steering arrangement, anchors and windlass examined and found good.

Propellers and outside fastenings of seaconnections examined and
found good. Weardown tailshafts Port : 1 mm. Starb.: 0.5 mm.

Port and Starboard main engines cylinders covers removed and replaced
by new cylinder covers.

Port main engine pistons drawn, cylinders, pistons, crankpins and
crasses examined and found good. New gudgeon pins, made of tested
material, fitted, gudgeon pinbushes bored out.

The Ship

© 2021

This Certificate is granted subject to the condition that it is understood and agreed that neither the Bureau nor any of its Committees is under
any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by this Bureau or its Surveyors or in any
entry in the Record or other publication of the Bureau or for any error of judgment, default or negligence of its Officers, Surveyors or Agents.

003687-003694-0114 1/2

Lloyd's Register
Foundation

American Bureau of Shipping

45 BROAD STREET, NEW YORK 4, N. Y.


(THIS FORM IS TO BE USED IN CONFIRMATION OF CLASS ONLY.)

S.87 - ms."NASSAU"

SBA.- 10th December 1952.-

The Ship and its Machinery being in good condition the
Undersigned is opinion that she may be continued in her
present class with fresh record of docking 11.52 and
notation of AS 12.52 and An.MS. 12.52

Fee & expenses Rp.700,--.
(Rp.: SEVEN HUNDRED,only) for cert.S.87

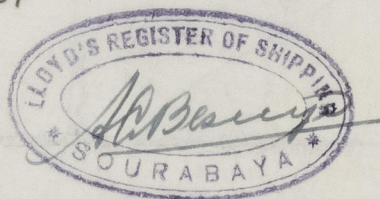

This Report is issued subject to the condition that it is understood and agreed that neither the Bureau nor any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by this Bureau or its Surveyors or in any entry in the Record or other publication of the Bureau or for any error of judgment, default or negligence of its Officers, Surveyors or Agents.

Printed in U.S.A.

© 2021

Lloyd's Register
Foundation

0114 12