

COPY

LLOYD'S REGISTER OF SHIPPING

A/c No. 5022



Hong Kong Rpt. A/c No. 5022

Survey Fee \$120.00

Expenses \$10.00

Total \$130.00

nplic

4.1.61.

Port HONG KONG,

4th January, 1961.

This is to Certify that

J.L.V. WHITTLE

the undersigned Surveyor to this Society did at the request of The Taikoo Dockyard & Engineering Company of Hong Kong Ltd., attend at their Works on the 30th December, 1960, & subsequently, for the purpose of examining during repair and testing on completion

ONE MILD STEEL RECTIFIER,

stated intended to be refitted to the ammonia refrigerating machinery of the s.s. "Taiping" 4324 tons gross, of Hong Kong.

The mild steel tubular shell of this rectifier has been renewed with a mild steel seamless tube, 12.75 inches outside diameter X 4'-0-3/8" long X .375 inches thick. The original end plates have been refitted, using approved welding processes.


On completion the vessel was subjected to a hydraulic test of 500 lbs. per sq.in., and also an air test of 250 lbs. per sq.in. whilst immersed in water, and all found sound and tight.

For identification the vessel was stamped on the shell:-

"LLOYD'S TEST 500 LBS. HYD. 250 LBS.

AIR J.L.W. H.KG. 31 DEC. 60."

(Signed) J.L.V. Whittle
Surveyor to Lloyd's Register.

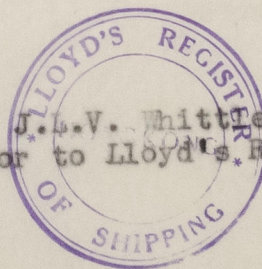

Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-

While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly performed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."