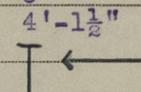


Lloyd's Register of Shipping.

Ship's Name "HIGHLAND MONARCH" Official No. 148158.

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in _____

New Hatchway to No. 2 Hold Built on Forecastle Deck Extension.

Description of Hatchway	No. 2	
Dimensions of Hatchway	22'-6" x 16'-0"	
Coamings	(Ht. above Deck	24"
	(Thickness (sides	.44"
	(ends	.44"
	(Stiffeners	7" x 3" x .38" BA ^S
	(Brackets, stays	2 @ 1½" solid round stays each side.
Hatch Beams	(Number	5
	(Spacing	4'-1½"
	(Scantling & sketch	
	(Bearing surface	3"
Fore and afters	None	
Hatch Covers	(Material	W.P.
	(Thickness	3"
	(How Fitted	F & A
	(Bearing surface	3"
Spacing of cleats	22" to 24"	
Number of tarpaulins	3	

Battens, wedges and tarpaulins have been supplied and are in good condition, and in accordance with Rule requirements.

Lashings are provided in accordance with Rule requirements.

T.R. McIlvenna

Surveyor to Lloyd's Register of Shipping.

LONDON.

January, 1948.

Notes
AD
20-1-48

