

of CARDIFF.

28th. May 1920.

James Petres.

Ministry of Shipping, survey the steel screw steamer

"GOLDENFELS"

tons gross, of London, for the purpose of ascertaining the  
and extent of damage stated due to collision with Steamer  
"VORHANN".

and recommended as follows:-

Board bow.

Deck and mouldings damaged. To be partly renewed.

Deck damaged Repair and refit.

Pipe to examine.

Plates (Nos 1, 2) damaged. To cross cut and renew in one  
plate.

ing in way. Remove and refit

Castle guard rails and Repair and refit.

ions.

Forecastle deck stringer To renew.

and angle.

Sheathing. Remove and replace.

Castle deck. To caulk.

Castle ventilators. Overhaul and repair.

to range for examination

replace.



© 2021

Lloyd's Register  
Foundation

006358-006368-0059 1/2



ore to examine.

lavit broken.

ng stanchion and ridge

y damaged (part lost).

lass and connections.

's bell damaged.

castle fittings.

Knock framing etc, to be examined.

disturbed work to be replaced, and repairs coated inside and

so as to place the vessel in the same good and efficient

ition as before the damage was sustained.


To renew.

Repair, part new.

To examine and overhaul.

To repair.

Remove for access, and refit.

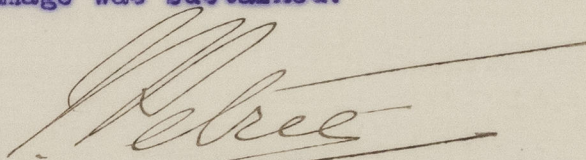

SURVEYOR TO LLOYD'S REGISTER OF SHIPPING.



© 2021

Lloyd's Register  
Foundation

0059 2/2