

C O P Y
Lloyd's Register of Shipping.



Port Kobe.

18th March, 1941.

This is to Certify that

Y. Hamada,

the undersigned Surveyor to this Society did at the request of Messrs. Meiji Kaun Kaisha, Ltd., survey the

T.S.S. "MEIU MANU",

8230 tons gross, of Dairen,

on the 6th March, 1941 and subsequently, whilst the vessel lay in dry dock at Tema, for the purpose of ascertaining the nature and extent of damage stated to have been caused by the starboard propeller touching aground on the 31st January, 1941 at Nukuelofa, Tonga, whilst shifting berth and striking some submerged object on the 4th March, 1941 at the position N. Lat. 33° - 25', E. Long. 132° - 4', whilst on a voyage from Saganoseki to Uno.

For further particulars see Log Books.

Vessel placed in dry dock.

The undersigned upon examination,

FOUND

RECOMMENDED

Starboard Propeller:-


4 manganese looge bladed built up propeller:-

"C" blade, broken off at the tip.	To be repaired or renewed as necessary.
-----------------------------------	---

"A" blade, bent at the tip.	To be faired.
-----------------------------	---------------

(continued).

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—
"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

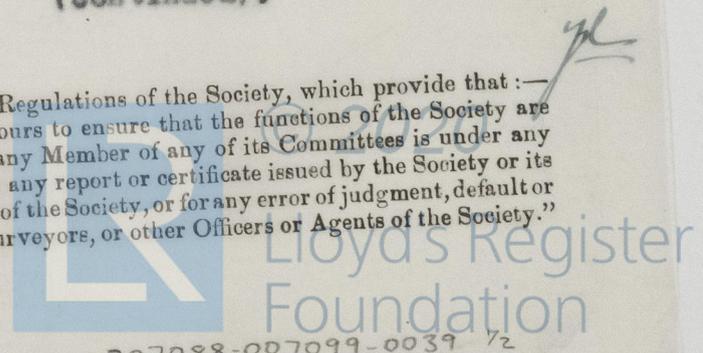

COPY

(2)

T.S.S. "MEIU MARU",

Kobe, 18th March, 1941.

The foregoing recommendations were made in order to place the vessel in as well a condition as before the damage was sustained and fairing of "A" Blade has now been satisfactorily completed.

J. Hamada
Surveyor to Lloyd's Register.

Fee & Expenses as per Account.



© 2020

Lloyd's Register
Foundation