

Received by Chief Ship Surveyor 7. 11. 19

Received from Chief Ship Surveyor 110 NOV 1919

VESSEL'S NAME Stl.Sc.K. "BEN BREAC".

Rpt. Fal. No. 5822

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

Nature of Survey

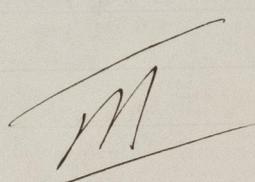
The Falmouth Surveyors now report this vessel has been placed in dry dock for reconditioning, the bottom cleaned & coated, 1 shell plate renewed & 2 faired in place, the riveting & caulking of shell overhauled, bulwarks repaired, hatches & fittings replaced, fish room cleaned & refitted, rigging &c. overhauled, and vessel refitted for fishing purposes.

15 fathoms of chain cable of proper size & test &c. supplied.

The sole piece of stern frame, slightly scored, has been built up by electric welding.

It is submitted the vessel appears worthy to remain as classed, with record of survey 10.19.

100A.1. Steam Trawler
10-19 Fal


10 11. 19

The Surveyors should be again requested to state what part of the Special Survey No.1, due 7.20, has been covered by the examination now made.



© 2021

Lloyd's Register
Foundation

007168-007176-0045