

COPY

of Montreal.

December 17th, 1919

William R. M. Aspinall,

and
the Owners Superintendant ¹Mr. Henry Black of the Salvage Association attend on board the S. S. "CANADIAN SETTLER" of Montreal 3548/2155 tons register on December 9th, and 10th, 1919, while lying at Pier 19, Louise Basin Quebec in order to ascertain the nature and extent of the damage stated to have been sustained when moored at the River Quay Quebec on December 8th, 1919, when the vessel is stated to have broken adrift due to the strong ebb tide and mass of floating ice.

For further particulars see log books.

The undersigned found damage as follows and made the following recommendations.

FOUND.

Three ropes parted and destroyed.
One @ 90 fms 6" and one @ 90 fms 7"
manilla and one 2½" flexible steel wire.

Centre roller of starboard forecastle
fairleader broken off.


Starboard bollard on forecastle broken

RECOMMENDED.

New ropes be supplied
to replace those
destroyed.

New roller with larger
pin be fitted to
forecastle fairleader.

New bollard be supplied
and fitted.

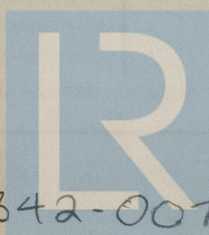

© 2021

Lloyd's Register
Foundation


007342-007351-021912

Warping shaft of windlass bent
bent due to broken bollard striking
warping end and stud bolt in keep of
shaft bearing broken.

Warping shaft to be removed,
straightened, and refitted,
warping end to be removed,
to effect this straightening
and to be afterwards replaced.
New stud bolt to be fitted in
keep.

The above recommendations were made by the undersigned
with a view to placing the vessel in as good condition as prior
to the alleged casualty.

Wm. A. M. Aspinwall
Surveyor to Lloyd's Register

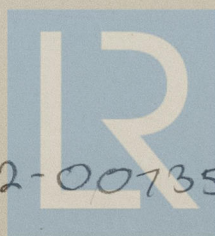

© 2021

Lloyd's Register
Foundation

007342-007351-0279²/₂