

L O N D O N .

6th September, 1923.

JAMES DAGLISH,

the Owners' representative attend on board s.s. "WAR HINDOO", 5565 tons gross of London, and No.36835 in the Society's Register Book, whilst lying afloat in the River Medway on the 15th August, 1923, and subsequent date, for the purpose of ascertaining the nature and extent of damage stated caused through collision with Tug "WRESTLER" off Antwerp, 2nd August, 1923.

For further particulars please see ships log book.

FOUND:

RECOMMENDED:

Starboard Side:

Sheerstrake No.6 plate indented.

To be faired in place.

1st strake below sheer No.5 plate indented.

To be removed, faired and refitted.

One longitudinal fractured.

To be cropped and part renewed.

One frame set in.

To be faired in place.


Tank to be tested.

The foregoing recommendations were made for the purpose of placing the vessel in the same good condition as she was prior to the casualty.

Fee:-£3:3:0

Expenses:-£2:7:0

J.D.
Surveyor to Lloyd's Register of Shipping.

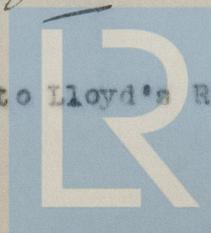

© 2021

Lloyd's Register
Foundation

008087-008095-0069