

REPORT ON ELECTRIC LIGHTING INSTALLATION. No. 10894

Port of MIDDLESBRO' Date of First Survey Aug Date of Last Survey While Building No. of Visits 1
 No. in 68260 on the Iron or Steel ss. P.L.M. 12" Port belonging to Smith's Dock Co. Ltd.
 Reg. Book 68260 Built at Middlesbrough By whom Smith's Dock Co. Ltd. When built 1920
 Owners Societe Nationale d'Affrètements Owners' Address 100
 Yard No. 60 Electric Light Installation fitted by Smith's Dock Co. Ltd. When fitted 1920

DESCRIPTION OF DYNAMO, ENGINE, ETC.

One single cylinder double acting open type vertical engine direct coupled to a continuous current compound wound dynamo

Capacity of Dynamo 230 Amperes at 100 Volts, whether continuous or alternating current continuous

Where is Dynamo fixed In Engine Room Whether single or double wire system is used Double

Position of Main Switch Board Near Dynamo having switches to groups A B C D E F of lights, &c., as below

Positions of auxiliary switch boards and numbers of switches on each Each light & group of lights provided with switches as required

If fuses are fitted on main switch board to the cables of main circuit Yes and on each auxiliary switch board to the cables of auxiliary circuits Yes and at each position where a cable is branched or reduced in size Yes and to each lamp circuit Yes

If vessel is wired on the double wire system are fuses fitted to both flow and return wires or cables of all circuits including lamp circuits Yes

Are the fuses of non-oxidizable metal Yes and constructed to fuse at an excess of 50 per cent over the normal current

Are all fuses fitted in easily accessible positions Yes Are the fuses of standard dimensions Yes If wire fuses are used are permanent instructions fitted on or near each switch board giving particulars of proper size of fuse for each circuit Yes

Are all switches and fuses constructed of incombustible materials and fitted on incombustible bases Yes

Total number of lights provided for 138 arranged in the following groups:—

A Engine Room	37 lights each of	16	candle power requiring a total current of	20.7	Amperes
B Saloon	59 lights each of	16	candle power requiring a total current of	33	Amperes
C Aft	42 lights each of	16	candle power requiring a total current of	23.6	Amperes
D Wireless	- lights each of	-	candle power requiring a total current of	25	Amperes
E Cargo Chasing	- lights each of	-	candle power requiring a total current of	-	Amperes
2 Mast head light with	1 lamp each of	32	candle power requiring a total current of	2.2	Amperes
2 Side light with	1 lamp each of	32	candle power requiring a total current of	2.2	Amperes
- Cargo lights of	-	-	candle power, whether incandescent or arc lights	-	-

If arc lights, what protection is provided against fire, sparks, &c. -

Where are the switches controlling the masthead and side lights placed In Wheel House.

DESCRIPTION OF CABLES.

Main cable carrying 230 Amperes, comprised of 37 wires, each 12 S.W.G. diameter, .300 square inches total sectional area

Branch cables carrying 33 Amperes, comprised of 7 wires, each 16 S.W.G. diameter, .022 square inches total sectional area

Branch cables carrying 20.7 Amperes, comprised of 7 wires, each 18 S.W.G. diameter, .0125 square inches total sectional area

Leads to lamps carrying 1.1 Amperes, comprised of 1 wires, each 18 S.W.G. diameter, .0018 square inches total sectional area

Cargo light cables carrying - Amperes, comprised of - wires, each - S.W.G. diameter, - square inches total sectional area

DESCRIPTION OF INSULATION, PROTECTION, ETC.


Vulcanized india rubber taped & braided & lead covered armored & braided cable

Joints in cables, how made, insulated, and protected No joints except mechanical ones.

Are all the joints of cables thoroughly soldered, and the flux used not containing acids or other corrosive substances Yes Are all joints in accessible positions, none being made in bunkers, cargo spaces, or spaces which may at any time be used for carrying cargo, stores, or baggage Yes

Are there any joints in or branches from the cable leading from dynamo to main switch board No

How are the cables led through the ship, and how protected Lead armored & braided cable run in galvanized iron pipes along bulwark rail & clipped to same.

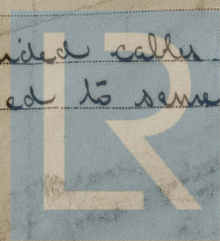

DESCRIPTION OF INSULATION, PROTECTION, ETC.—continued.

Are they in places always accessible Yes

What special protection has been provided for the cables in open alleyways or where exposed to weather or moisture Lead lined & braided cables run in galvanized iron pipes

What special protection has been provided for the cables near galleys or oil lamps or other sources of heat Lead & armoured cables

What special protection has been provided for the cables near boiler casings " " "

What special protection has been provided for the cables in engine room " " "

How are cables carried through beams In lead bushes through bulkheads, &c. in WT glands

How are cables carried through decks In galvanized iron deck tubes

Are any cables run through coal bunkers Yes or cargo spaces No or spaces which may be used for carrying cargo, stores, or baggage No

If so, how are they protected Lead lined & braided cables

Are any lamps fitted in coal bunkers or spaces which may at times be used for cargo, coals, or baggage No

If so, how are the lamp fittings and cable terminals specially protected -

Where are the main switches and fuses for these lights fitted -

If in the spaces, how are they specially protected -

Are any switches or fuses fitted in bunkers No

Cargo light cables, whether portable or permanently fixed -

How fixed -

In vessels fitted on the single wire system, how is the dynamo terminal fixed to the hull of vessel Double wire system

How are the returns from the lamps connected to the hull -

Are all the joints with the hull in accessible positions -

Is the installation supplied with a voltmeter Yes, and with an amperemeter Yes, fixed in switchboard

VESSELS BUILT FOR CARRYING PETROLEUM

In vessels built for carrying petroleum, are all switches and fuses fitted in positions not liable to the accumulation of petroleum vapour or gas -

Are any switches, fuses, or joints of cables fitted in the pump room or companion -

How are the lamps specially protected in places liable to the accumulation of vapour or gas -

The copper used is guaranteed to have a conductivity of not less than that of the Engineering Standards Committee's standard, and the wires are protected by tinning from the sulphur compounds present in the insulating material.

Insulation of cables is guaranteed to have a resistance of not less than 2,500 megohms per statute mile at 60° Fahrenheit after 24 hours' immersion in water, the test being made after one minute's electrification at not less than 500 volts and while the cable is still immersed.

The foregoing statements are a correct description of the Electric Light installation fitted by us on this vessel and we declare that it is at this date in good order and safe working condition.

For Clarke, Chapman & Co., Ltd.

Electrical Engineers

Date

Feb 21st 1921

COMPASSES.

Distance between dynamo or electric motors and standard compass 180 ft

Distance between dynamo or electric motors and steering compass 180 "

The nearest cables to the compasses are as follows:—

A cable carrying	Amperes	feet from standard compass	feet from steering compass
1.1	12	6	
1.1	6	12	
.	.	.	

Have the compasses been adjusted with and without the electric installation at work at full power Yes

The maximum deviation due to electric currents, etc., was found to be Nil degrees on all course in the case of the standard compass and Nil degrees on all course in the case of the steering compass.

FOR SMITH'S DOCK COMPANY.

JW Bairns

Builder's Signature.

Date

Feb 23rd 1921

GENERAL REMARKS

This installation has been fitted in accordance with the Rules, the materials and workmanship are good and tested under full working conditions with satisfactory results

It is recommended that this vessel be fitted for Elec Light.
Kell, 1/3/21


Y Thomas Miller

Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

Im 914—Transfer.

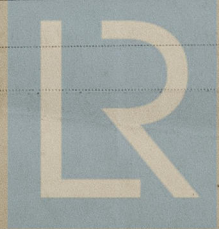

© 2020

Lloyd's Register Foundation