

TUE. 27 SEP. 1921

Index No. 28818
(For London Office only.)Lloyd's Register of Shipping.
SURVEYS FOR FREEBOARD.—STEAM SHIPS.

No. 19886.

PARTICULARS RELATING TO ALL STEAM SHIPS EITHER FLUSH DECKED, OR WITH TOP GALLIES, FORECASTLES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR WITH TOP GALLIES, FORECASTLES, SHORT POOPS, OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey *Greenock*
Date of Survey *While Building*
Name of Surveyor *R.D. Cairns*

Ship's Name	Port of Registry and Nationality.	Official Number.	Gross Tonnage.	Date of Build.	Particulars of Classification.
<i>S.S. "FAUSANG"</i> <i>Dunlop Bremner & Co. No. 345</i> Number in Register Book	<i>London</i> <i>British</i>	<i>146179</i>	<i>✓</i>	<i>Building</i>	<i>+100 A.I. (Contemplated)</i>

Registered dimensions from Ship's Register.	LENGTH.	BREADTH.	DEPTH.	UNDER DECK TONNAGE.
	<i>285.0</i>	<i>42.65</i>	<i>20.0</i>	<i>1860.75</i>
Length on LOADLINE.	<i>285.0</i>	Frame Depth Rule <i>62 1/2</i> = <i>25 1/2</i>	Ceiling <i>7.20</i> Sheer <i>7.82</i>	Peak } <i>mil</i> Tanks }
CORRECTED DIMENSIONS.	<i>285.0</i>	<i>42.4</i>	<i>21.02</i>	<i>1860.75</i>

Co-efficient of fineness.....

Any modification necessary }
[Para. 4 (a) to (e)]*

Co-efficient as corrected

Sheer { Stem..... *84*
at { Sternpost... *45* } $129 \div 2 = 64.5$ Mean

Sheer at $\frac{1}{8}$ of the length from { Stem *50.25*
Sternpost *24.75* } $75 \div 2 = 37.5$ Mean

Gradual mean Sheer *68.18* allowed *66.34* $\div .55 = 68.18$

Standard mean Sheer [Table, Para. 18] *38.5* Correction

Difference..... $27.84 \div 4 = -7$

§ If limited as Para. 18 (f)

Rise in Sheer { At front of bridge house.....
from amidships {
[Para. 18 (e)] { At after end of forecastle

Fall in Sheer }
Para. 18 (d) } $\div 2 =$
Length uncovered Correction

ALLOWANCE FOR DECK ERECTIONS:—

Freeboard, Table C..... *1-9 1/4*

Correction for Length, if required (Para. 12, 13, and 14) \checkmark

Freeboard by Table A, corrected for sheer, and for length, if required (Para. 12, 13, and 14) *3-10 3/4*

Difference *2-7 3/4* $0 3/4$

Percentage as below..... *40.568*
10.35 04

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11) }

Allowance for Deck Erections *10 1/4*

	Length.	Length allowed.	Height.
Forecastle.....	<i>38.16</i>	<i>38.16</i>	<i>7.3</i>
Bridge House.....	<i>104.0</i>	<i>101.85</i>	<i>7.3</i>
† Raised Qr. Dk.....			
Poop.....	<i>32.66</i>	<i>32.66</i>	<i>7.3</i>
Total	<i>172.67</i>	<i>172.67</i>	<i>60.568</i>
Length of Ship	<i>285.0</i>		
Corresponding percentage { (Para. 12, 13, and 14) } <i>40.568%</i>			

FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Deck) Deck:—

entry	Fresh Water Line	above centre of Disc	
Comm	Indian Summer Line	" "	
(Rpt. 10.)	Winter Line	below "	
	Winter North Atlantic Line	" "	

† If the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.

† In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R.Q.D. is taken from the level of the top of the amidship beam.

§ In flush-decked vessels the total standard mean sheer means the sheer measured at the stem and sternpost. In vessels having poops and forecastles, it means the sheer measured at points distant one-eighth of the vessel's length from stem and sternpost.

Moulded Depth as measured..... *22'-3"*

Addition for Keel below base line for draught record..... *2 1/2* inches.

CORRECTION FOR LENGTH.

Length of Ship on Loadline..... *285*

Length in Table *267*

Difference *18*

Correction for 10ft., Table A. *1.2* Table C.

× Difference divided by 10 *2.16* (if required.)

If $\frac{1}{10}$ ths length covered divide by 2 *+1*

CORRECTION FOR IRON DECK.

Proportion covered, if less than $\frac{1}{10}$ ths length covered *60.568%*

Thickness of usual wood deck, less stringer *1" x .622*

2 1/2 Inch Sheathing instead of *3 1/2* *- 3/4 1/2*

CORRECTION FOR ROUND OF BEAM.

Breadth at Gunwale amidships..... *42'-6"*

Round of Beam *10 3/4*

Normal round..... *10 1/2 .62*

Difference $\checkmark 13 \div 2 = .07$ \checkmark

Proportion of Deck uncovered (Para. 19) \checkmark

NOTE.—The round of beam should be reported on the full breadth of vessel at the gunwale.

Freeboard, Table A *4-5 1/4*

Correction for Sheer *-7*

Correction for Length *+1*

Allowance for Deck Erections *-10 1/4*

Correction for Round of Beam..... \checkmark

Correction for fall in Sheer (if any)..... \checkmark

Correction for Iron Deck (if required) *-3 1/4 1/2*

Additions for non-compliance with provisions of }
Para. 11 (d) and (e) † } \checkmark

Other Corrections (if any) \checkmark

Winter Freeboard *3-0 1/4*

Summer Freeboard *2-9 1/4*

Indian Summer Freeboard *2-5 1/4*

N. A. Winter Freeboard *3-2 1/4*

Correction necessary because clearside amidships, measured in accordance with the Statute is not taken at the intersection of the wood deck with side. *+1 3/4*

Winter Freeboard from deck line *3-2 1/4*

Summer " " " *2-10 1/2*

Indian Summer " " " *2-7 1/4*

N. A. Winter " " " *3-4 1/4*

2020

† State dimensions of freeing port area on back of this form.

The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft should be reported.

MARKING REPORT
RECEIVED 5.10.21


Do all the Frames extend to the top height in the Poop? *Yes* - Raised Quarter Deck? *Yes* - Bridge House? *Alt. form* Forecastle? *Yes* -
 To what height do the Reverse Frames extend? *Deep Bulk Angle framing* -
 Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? *Yes* -
 Give particulars of the means for closing the openings in Bulkhead *One Oak Hinged door 5'-6" x 2'-6"*
 Is the Poop or Raised Quarter Deck connected with the Bridge House? *No* - Has the Bridge House an efficient Bulkhead at the fore end? *Yes* -
 Give particulars of the means for closing the openings in Bulkhead *Two Steel hinged W.T. doors 5'-6" x 5'-0"*
 What is the thickness of the Bridge Front plating? *36* - and Coaming plate? *40* -
 Give scantlings and spacing of the Stiffeners *7 x 3 x 56 B.A. x 10 x 3 1/2 x 60 B.A. each side of W.T. doors. Spaced 28 1/2"*
 Are bracket plates fitted at each end of the Stiffeners? *Yes* - Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks? *Yes* -
 Has the Bridge House an efficient Iron Bulkhead at the after end? *Yes* -
 How are the openings closed? *Storm board full height in united Channel* -
 Is the Forecastle at least as high as the main or top-gallant rail? *Yes* - Has the Forecastle an efficient Iron or Wood Bulk'd. at after end? *Yes* -
 Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse? *Covered by Strong Steel Casings on top of Bridge Deck* -
 If the openings are not so protected are the exposed parts of the Casings efficiently constructed? *Yes* -
 Give thickness of plating; scantlings and spacing of Stiffeners *Yes* -
 What is the height of the exposed Casings? *Yes* - Are suitable means provided for closing all openings in them in bad weather? *Yes* -
 Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below: - *Yes* -

Position and Size.		No. 1 29'2" x 18'-0"		No. 2 32'-0" x 18'-0"							
Item.		Ship.	Rule app.	Ship.	Rule app.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.
COAMING.	Height above top of DECK	36	36	36	36						
	Sides	44	44	44	44						
	Ends	44	44	44	44						
SHIFTING BEAMS OR WEB PLATES.	Number	5		6							
	Section and Scantlings	4 x 3 x 16 x 36	20	4 x 3 x 16 x 36	20						
	Material	Steel									
* FORE AND AFTERS.	Number	none		none							
	Section and Scantlings										
	Material										
HATCHES Thickness		3" W.P. d.		3" W.P. d.							
Remarks											

* The depth of Fore and Afters should be stated from the underside of the hatches in all cases.
 (If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)
 The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.
 What is the thickness of the Bridge Sheerstrake? _____ Strake between Main and Bridge Sheerstrakes? _____

Delete the words { The Crew are, are not, berthed in the bridge house.
 that do not apply { The arrangements to enable them to get backwards and forwards from their quarters are, are not satisfactory.

Length of Bulwarks in well _____ Sq. ft.
 Area of Freeing Ports required by Para. 11 (e) each side of vessel = _____ Sq. ft.
 Ft. Tenths. Ft. Tenths. No. } Freeing Ports (each side of vessel) = _____ Sq. ft.
 x x
 x x
 Total deficiency or excess = _____ Sq. ft.

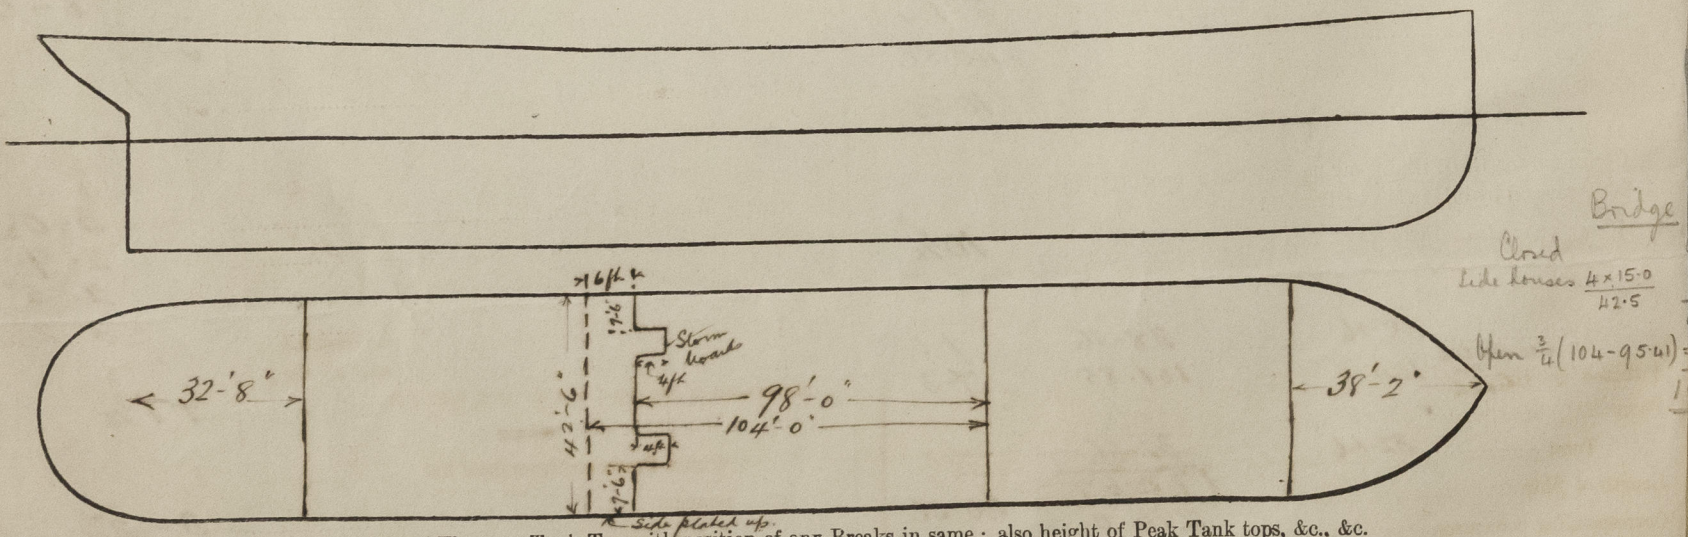

Show hereon line of Floors or Tank Top with position of any Breaks in same; also height of Peak Tank tops, &c., &c.
 State any special features in the construction of the Vessel *Please see Secy's letter M 6/4/20 for Preliminary Assignment*
Plans of Midship Section, Profile decks, Details of Cargo doors & their plan showing Position & arrangements in way of Cargo doors (4 plans) Freeboard Request herewith.
 Builders *Messrs. Dunslop, Bremner & Co. Ltd.*

Address *Such Works Port Glasgow.*
 Received by me *See 7th Report.*