

COPY

Ship's name MS LIBURNIA"

Port PALERMO No. 1098

Class is subject to

Last survey date

5.7.64

- ① The two port wasted sea connection valves in forward + centre cargo pump rooms being renewed by 2.65.

Docking - stem bulk re-wooded to close fit to suit new TS.

TS due 2.67 - now held.

Surveyor reports alleged damage to working propellers (bronze).

Propellers removed + cast iron propellers now fitted.

Screw shaft cracked at top of cone + spare new screw shaft now fitted.

Recommends cast iron propellers now fitted to be renewed at earliest opportunity or before the end of October 1964 (4 months limit).


Intermediate shaft scored journals machined, after coupling bolt holes reamed + new bolts fitted.

C.S. Advanced.

It is submitted that this vessel is eligible to remain as **CLASSED**.

+ CSU (with date) when the survey has been completed subject as item ① + as now recommended.

TSP
26.8.64
© 2021

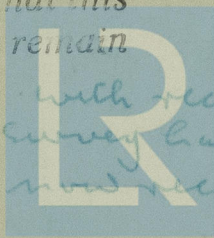

Lloyd's Register
Foundation