

41126
17 MAY 1950

Lloyd's Register of Shipping.

Ship's Name S.S. "LLANVERN".Official No. 162233

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in _____

The following alterations have now been carried out:-

(1) Existing drain scuppers in tonnage well P. & S., now removed and openings in deck plating closed by E.W. closing plates. New 5" dia.

G.M.

Overboard scupper valves fitted, having screw down non-return valves, controlled from the shelter deck and fitted with indicators.

(2) 3P & 3S existing overboard scuppers from the tween deck spaces now removed and openings in shell plating closed by E.W. spigoted closing plates.

(3) 2P & 2S, 3" dia. drain scuppers fitted in 'tween deck spaces amidships, leading to the machinery space bilges and fitted with self closing cocks in accessible positions at the lower ends.

Alterations examined on completion and found satisfactory.


The former washport doors in the tonnage well were noted to have previously been closed up permanently by E.W.

AMB Edwards

SURVEYOR TO LLOYD'S REGISTER
OF SHIPPING, HULL.

28.4.50.

(Copy issued to ship.)

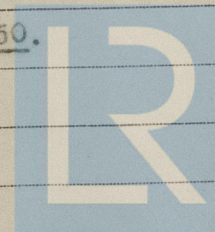

Lloyd's Register
Foundation

012446 - 012459 - 0341