


COPY

LLOYD'S REGISTER OF SHIPPING

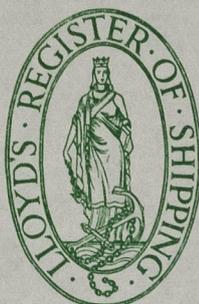

No. H-588 (Amended)

Port HAKODATE

Date 24th December, 1963

This is to Certify *that I have*

surveyed the S.S. "ELLI" 5,215 *Gross tons of Piraeus*
whilst vessel lay afloat and in drydock at Hakodate, Japan on the 18th
December, 1963 and subsequently for docking survey, condition and
damage (1) stated to have been caused by contacting with dock gate on the
17th December, 1963 at Hakodate, Japan, and damage (2) stated to have
been caused by heavy weathers on 27 and 28-11-63 during voyage from
Newcastle, N.S.W. to Nakhodak U.S.S.R. and on 15-12-63 during voyage
from Nakhodaka, U.S.S.R. to Hakodate, Japan.

and that I am transmitting to the Committee of Lloyd's Register of
Shipping, London, a report, stating that all repairs recommended by
me have been completed to my satisfaction, also that I am
recommending that she be continued as now classed with fresh record
of Docking Survey "DS-12/63" without condition regarding the frames in
Nos.4 hold and side shell H-11, J-10(s.s.f.), subject to side shell
D-2(p) in way of tunnel bilge well and F-14(p) in way of No.1 hold aft
being renewed and F-14(s) indented being dealt with as necessary at
next drydocking and any outstanding condition attached to vessel's
class being dealt with as previously recommended.


Surveyor to Lloyd's Register of Shipping
K. Ikehata

KEY TO ABBREVIATIONS


AS	Annual Survey	SS	Hull Special Survey
BiS	Biennial Survey	SS(Dr)	Hull Special Survey (Drilling)
DS	Docking Survey	SS(M)	Hull Special Survey (Modified)
NS	Cargo Battens not fitted (No Sparring)	CSH	Hull Special Survey (Continuous)

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

Cert. B 150m,7,62 (MADE AND PRINTED IN ENGLAND.)

© 2021

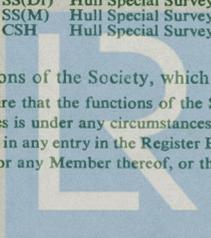

Foundation

013168-013171-0284