

20 FEB 1953

Received from Chief Ship Surveyor

SHIP'S NAME "RAMA RAJA"

REPORT Cal. No. 15414

Outstanding Conditions of Class: Subject to rudder head (E.W.2,50) being specially examined, and to permanent repairs to indented stem and stem plating, etc. by next drydocking, also to after end plate of No.3 D.B. tank being renewed at the next Special Survey.

ACTION is DEFERRED for Special Survey,

Endorsement of Class (B) (As before ~~XXXXXX~~)

Surveys due: SPECIAL SURVEY (C) due 6,52 - postponement until 6,53 approved 18.6.52 provided temporary damage repairs effected to stem, stem plating, etc. at Madras from examination are found efficient.

Nature of Present Survey: (Afloat ~~XXXXXX~~)

Examination of stem damage temporary repairs.

Special Features:

Is Interim Certificate in order (Yes-~~XXXXXX~~)

Items Outstanding: (~~XXXXXX~~ for S.S. ~~XXXXXX~~) All S.S. requirements.

S.S. to be completed by: 6,53.

Recommendation:


SUBJECT to rudder head (E.W. 2,50) being specially examined at the next drydocking, to after end plate of No.3 D.B. tank being renewed and to permanent repairs to indented stem and stem plating, etc., by the Special Survey, with Endorsement (B), but further ACTION continue to be DEFERRED for Special Survey.

As Now. Subject  
Amended.

ENDORSEMENT OF CLASS (B).  
Indents in strakes 'E' & 'F'  
of shell plating (s.s.).

NOTE:- The figure '1' will be reinstated when a stream anchor and 75 fathoms of chain cable are supplied.

© 2021

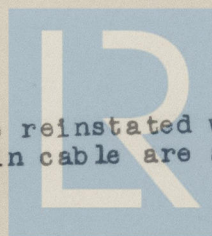

Lloyd's Register  
Foundation

015355-015365-0099